

SURVEY: LEAD-BASED PAINT

Stevens Point Housing Authority

Site:

Hi-Rise Manor
1300 Briggs Court
Stevens Point, WI 54481

Work Area:

Throughout Apartments & Common Areas

Inspection Date: December 4 - 6, 2024

Report Date: December 18, 2024

NorthStar No. 240-1442A

Central Wisconsin
715.693.6112

Fox Cities
920.422.4888

Madison
608.827.6761

Sheboygan
920.422.4888

Asbestos • Lead Paint • Mold • Indoor Air Quality • Industrial Hygiene

December 18, 2024

Stevens Point Housing Authority
c/o Jay Feltz
1300 Briggs Court
Stevens Point, WI 54481

Project:	Survey: Lead Paint (XRF)
Site:	Hi-Rise Manor 1300 Briggs Court Stevens Point, WI 54481
Work Area:	Apartments & Common Areas
Site Date:	December 4 - 6, 2024
NorthStar No.	240-1442A

NorthStar Environmental Testing, LLC (NorthStar) was authorized by Jay Feltz on behalf of Stevens Point Housing Authority to perform limited, non-destructive screening for the presence of lead in paint on surfaces located throughout the apartment building located in Stevens Point, WI.

Testing for lead-based paint was conducted on representative accessible surfaces throughout the apartment building. A surface-by-surface visual assessment of building components was conducted at the property to determine which surfaces to test.

TESTING SUMMARY:

Testing Date:	December 4 - 6, 2024		
Building/Site:	1300 Briggs Court Stevens Point, WI 54481		
Building Type:	Residential & Commercial (apartment building with first floor office suite)	Building Age:	Pre-1978
Contact:	Jay Feltz	Phone:	715.204.0632
Work Area:	Throughout		
Regulatory Limit:	Wisconsin = 1.0 mg/cm ² (by XRF analysis)		
Materials Tested:	All accessible painted and varnished building materials.		
Lead Paint Result:	Lead-based paint was identified on the maintenance shed downspout and on piping located within the boiler room.		
Visual Assessment:	Deteriorated lead paint was identified on piping located within the boiler room.		
Sampling Technician:	Noah Lemanski	Certification:	LRA-290509
Lead Company:	DHS-925800	Expiration:	08/01/2025
Testing Equipment:	Heuresis PB 200e, Serial Number: 1344		
Comment:	Testing was limited to accessible areas. Other areas or surfaces should be assumed to contain lead unless additional testing proves otherwise. In accordance with HUD testing requirements, 24 apartment units (of the 73 total units) were chosen for testing.		

LEAD PAINT SUMMARY (positive testing locations):

Testing for lead-based paint analyzes all layers of paint on a particular surface area simultaneously. The testing does not specifically identify which layer or color of paint contains lead. A positive testing location entails that some layer of paint on that particular surface contains lead in paint in excess or equal to 1.0 mg/cm².

Reading No.	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm ²)
Exterior								
Exterior Maintenance Shed								
1223	B	Downspout	Ctr		Intact	Metal	Black	1.9
Commons								
First Floor - Boiler Room								
1293	C	Pipe	Ctr		Poor	Metal	Yellow	1.9
1294	C	Pipe	Rgt		Poor	Metal	Yellow	2.4
1301	A	Pipe	Rgt		Intact	Metal	Red	1.5

Note:

- Wall A (South) is the street/road side (Briggs Court) of the building. Walls B/C/D are determined clockwise from Wall A.
- All similar materials with the same paint history are to be categorized in the same manner. For example, if a window sill on side A is positive for lead-based paint, then all similar window sills are assumed to contain lead-based paint unless specifically tested and proven otherwise.
- Additional areas of lead-based paint are possible in inaccessible areas, areas hidden from view or materials/substrates contained behind or within other building materials.

See full testing data & building diagram for more specific location information.

DISCUSSION:

The EPA and HUD defines LBP as equal to or greater than 1.0 mg/cm² measured by X-ray fluorescence (XRF) analysis, or 0.5% (5000 ppm) measured by weight through laboratory analysis. The State of Wisconsin has adopted the same definition of lead-based paint (primarily for residential HUD applications and for building demolition/disposal).

Our non-destructive testing by XRF has been performed in an attempt to screen for areas with quantifiable lead above regulatory limits on painted substrates. The reportable limit of detection is essentially 1.0 mg/cm² by XRF analysis and therefore paint chip analysis would be recommended for a more accurate determination of lead in paint below this level or to rule out lead in any quantifiable amount. The calibration of the XRF analyzer was verified before and after testing by taking three readings from a source known to contain 1.02 mg/cm² lead (NIST Standard Reference Material). The three positive calibration readings were followed by a sample on bare wood containing no LBP.

For worker exposure applications, lead in any quantifiable amount, and disturbance of the material creating dust and/or fumes and subsequent potential worker exposure would be regulated by the OSHA Lead in Construction Standard (29 CFR 1926.62).

REMARKS:

The testing and subsequent report has been performed according to applicable regulations and generally accepted industry standards and practices in this locality under similar conditions. Information provided to us by the building owner/occupant, client or other interested party that may have been utilized in the performance and reporting of the testing was accepted in good faith and can only be assumed to be accurate. The findings and recommendations made are representative of our professional opinion based on currently available information; no other warranty is implied or intended.

Please contact us if you have any questions regarding the presented information or the project in general.

Submitted By,

NorthStar Environmental Testing, LLC.

A handwritten signature in black ink, appearing to read 'Dave Barrett'.

Dave Barrett
Operations Manager

A handwritten signature in black ink, appearing to read 'Noah Lemanski'.

Noah Lemanski
Project Technician

attach: XRF Lead Paint Testing Data
Site Diagram
Photo Log
Certifications

Stevens Point Housing Authority

**1300 Briggs Court
Stevens Point, WI 54481**

December 4 - 6, 2024

LEAD PAINT XRF TESTING DATA

Client:	Stevens Point Housing Authority	NorthStar No.	240-1442A
Location:	1300 Briggs Court Stevens Point, WI 54481	Site Date:	December 4 - 6, 2024
Work Area:	Apartments & Common Areas	Technician:	Noah Lemanski

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
December 4th Pre-Calibration								
1								0.9
2								1
3								0.9
4								0
December 5th Pre-Calibration								
730								1
731								1
732								0.9
733								0
December 6th Pre-Calibration								
1588								1
1589								1.1
1590								1
1591								0
Exterior								
Exterior Maintenance Shed								
1218	A	Wall	L Ctr		Intact	Concrete	Red	0.1
1219	A	Wall	U Ctr		Intact	Wood	Gray	0.4
1220	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1221	A	Door	Ctr	U Ctr	Intact	Metal	Gray	0
1222	B	Wall	L Ctr		Intact	Concrete	Red	0.2
1223	B	Downspout	Ctr		Intact	Metal	Black	1.9
1224	B	Wall	U Ctr		Intact	Wood	Gray	0
1225	C	Wall	U Ctr		Intact	Wood	Gray	0
1226	C	Wall	L Ctr		Intact	Concrete	Red	0
1227	D	Wall	L Ctr		Intact	Concrete	Red	0
1228	D	Wall	U Ctr		Intact	Wood	Gray	0
Exterior Apartment Building								
1755	A	Window	Lft	Lft casing	Intact	Metal	Tan	0
1756	A	Window	Lft	Lft casing	Intact	Metal	Tan	0.1
1757	A	Window	Ctr	Lft casing	Intact	Metal	Tan	0
1758	A	Window	Ctr	Lft casing	Intact	Metal	Black	0.1
1759	A	Window	Rgt	Lft casing	Intact	Metal	Brown	0.1
1760	A	Column	Ctr	L column	Intact	Metal	Black	0
1761	D	Railing	Ctr	Railing	Intact	Metal	Black	0.1
1762	D	Downspout	Rgt		Intact	Metal	Brown	0
1763	C	Window	Lft	Lft casing	Intact	Metal	Black	0
1764	C	Column	Ctr	L column	Intact	Metal	Gray	0.1
1765	C	Roof	Ctr		Intact	Metal	Gray	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
1766	C	Fascia			Intact	Metal	Gray	0
1767	C	Horiz Beam	Ctr		Intact	Metal	Gray	0
1768	C	Railing	Ctr	Railing	Intact	Metal	Gray	0
1769	C	Window	Rgt	Lft casing	Intact	Metal	Tan	0
1770	C	Window	Rgt	Lft casing	Intact	Metal	Tan	0
1771	C	Pipe	Rgt		Intact	Metal	Gray	0
1772	C	Trim	Rgt		Intact	Metal	Gray	0
1773	C	Soffit			Intact	Wood	Red	0
1774	A	Gutter			Intact	Metal	Gray	0
1775	A	Downspout	Ctr		Intact	Metal	Gray	0
Commons								
First Floor - Solarium								
5	A	Window	Ctr	Sash	Intact	Metal	Black	0.1
6	B	Window	Lft	Sash	Intact	Metal	Black	0
7	B	Door	Rgt	Lft casing	Intact	Metal	Gray	0
8	B	Crown Mldg	Ctr		Intact	Wood	Varnish	0.1
9	B	Door	Lft	Lft casing	Intact	Metal	Black	0
10	B	Door	Lft	U Ctr	Intact	Metal	Black	0
11	B	Door	Rgt	U Ctr	Intact	Wood	Varnish	0
12	B	Wall	L Ctr		Intact	Wood Pnl	Varnish	0
13	B	Chair rail	Ctr		Intact	Wood Pnl	Varnish	0.1
14	B	Wall	U Ctr		Intact	Drywall	White	0
15	C	Wall	U Ctr		Intact	Drywall	White	0
16	D	Wall	U Ctr		Intact	Drywall	White	0
17	C	Wall	L Ctr		Intact	Wood Pnl	Varnish	0.1
18	D	Wall	L Ctr		Intact	Wood Pnl	Varnish	0.1
19	D	Baseboard	Ctr		Intact	Wood Pnl	Varnish	0
20	D	Window	Rgt	Sash	Intact	Metal	Black	0
21	D	Door	Rgt	Lft casing	Intact	Metal	Black	0.2
22	D	Door	Rgt	U Ctr	Intact	Metal	Black	0.4
23	C	Heater Vent	Rgt		Intact	Metal	Gray	0
1537	D	Elec Panel	Lft		Intact	Metal	Gray	0.1
1538	D	Furnace	Lft		Intact	Metal	Gray	0
1539	D	Closet	Lft	Floor	Intact	Concrete	Gray	0.1
First Floor - Resident Services Center Main Room								
1229	A	Wall	U Ctr		Intact	Drywall	White	0
1230	B	Wall	U Ctr		Intact	Drywall	White	0
1231	C	Wall	U Ctr		Intact	Drywall	White	0
1232	D	Wall	U Ctr		Intact	Drywall	White	0.1
1233	A	Elec Panel	Lft		Intact	Metal	Gray	0
1234	A	Closet	Lft	Door Casing	Intact	Metal	Gray	0
1235	A	Closet	Lft	Door	Intact	Wood	Varnish	0.1
1236	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1237	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1238	A	Closet	Rgt	Door Casing	Intact	Metal	Gray	0
1239	A	Closet	Rgt	Door	Intact	Wood	Varnish	0
1240	A	Cabinet	Rgt		Intact	Wood	Green	0
1241	B	Heater Vent	Ctr		Intact	Metal	White	0
1242	B	Door	Lft	U Ctr	Intact	Metal	Gray	0
1243	B	Door	Lft	Lft casing	Intact	Metal	Gray	0
1244	C	Baseboard	Ctr		Intact	Wood	Varnish	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
1245	C	Window	Lft	Lft casing	Intact	Wood	Varnish	0
1246	C	Window	Lft	Sash	Intact	Wood	Varnish	0
1247	C	Window	Rgt	Lft casing	Intact	Wood	Varnish	0
1248	C	Window	Rgt	Sash	Intact	Wood	Varnish	0
1249	D	Door	Lft	U Ctr	Intact	Wood	Varnish	0
1250	D	Door	Lft	Lft casing	Intact	Metal	Gray	0
First Floor - Resident Services Center Bathroom								
1251	B	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1252	B	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1253	A	Wall	U Ctr		Intact	Drywall	White	0
1254	B	Wall	U Ctr		Intact	Drywall	White	0
1255	C	Wall	U Ctr		Intact	Drywall	White	0
1256	D	Wall	U Ctr		Intact	Drywall	White	0
1257	D	Wall	L Ctr		Intact	Cer Tile	Gray	0.3
First Floor - Maintenance Office								
1258	A	Wall	U Ctr		Intact	Conc Blk	White	0.1
1259	B	Wall	U Ctr		Intact	Conc Blk	White	0
1260	C	Wall	U Ctr		Intact	Conc Blk	White	0.1
1261	D	Wall	U Ctr		Intact	Conc Blk	White	0
1262	A	Ceiling			Intact	Wood	White	0
1263	A	Floor			Intact	Concrete	Gray	0.3
1264	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1265	A	Door	Ctr	U Ctr	Intact	Metal	Gray	0.5
1266	A	Shelf	Ctr		Intact	Metal	White	0.1
1267	A	Cabinet	Ctr		Intact	Wood	White	0
1268	A	Cabinet Door	Ctr		Intact	Wood	Gray	0
1269	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1270	C	Door	Ctr	U Ctr	Intact	Metal	Gray	0.1
1271	A	Column	Ctr	L column	Intact	Concrete	White	0.1
1272	D	Cabinet	Ctr		Intact	Metal	Gray	0
1273	D	Shelf	Ctr		Intact	Wood	White	0
1274	C	Trim	Ctr		Intact	Metal	Gray	0.4
First Floor - Boiler Room								
1275	A	Wall	U Ctr		Intact	Conc Blk	White	0.2
1276	B	Wall	U Ctr		Intact	Conc Blk	White	0.1
1277	C	Wall	U Ctr		Intact	Conc Blk	White	0
1278	D	Wall	U Ctr		Intact	Conc Blk	White	0.1
1279	A	Wall	L Ctr		Intact	Concrete	White	0
1280	A	Ceiling			Intact	Concrete	White	0.1
1281	A	Floor			Intact	Concrete	Gray	0.1
1282	A	Stairs	Rgt	Treads	Intact	Concrete	Gray	0
1283	A	Stairs	Rgt	Risers	Intact	Concrete	Red	0.3
1284	A	Stairs	Rgt	Stringer	Intact	Concrete	Red	0.1
1285	A	Door	Rgt	Lft casing	Intact	Metal	Gray	0
1286	A	Door	Rgt	U Ctr	Intact	Metal	Gray	0
1287	A	Stairs	Rgt	Railing cap	Intact	Metal	Yellow	0
1288	C	Base	Lft		Intact	Concrete	Red	0.2
1289	C	Bracket	Lft		Intact	Metal	Yellow	0
1290	C	Generator	Lft		Intact	Metal	Green	0
1291	C	Boiler	Ctr		Intact	Metal	Gray	0
1292	C	Pipe	Ctr		Intact	Metal	Black	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
1293	C	Pipe	Ctr		Poor	Metal	Yellow	1.9
1294	C	Pipe	Rgt		Poor	Metal	Yellow	2.4
1295	C	Pipe	Rgt		Intact	Metal	Gray	0
1296	A	Water Htr	Lft		Intact	Metal	Gray	0
1297	A	Elec Panel	Ctr		Intact	Metal	Blue	0
1298	A	Elec Panel	Ctr		Intact	Metal	Gray	0
1299	A	Elec Panel	Ctr		Intact	Metal	Gray	0
1300	A	Pipe	Ctr		Intact	Metal	Black	0.3
1301	A	Pipe	Rgt		Intact	Metal	Red	1.5
First Floor - West Hall								
1302	A	Wall	U Ctr		Intact	Wallpaper	White	0
1303	A	Railing	Ctr	Railing	Intact	Wood	Varnish	0
1304	B	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1305	B	Door	Ctr	U Ctr	Intact	Metal	Gray	0.6
1306	D	Door	Ctr	U Ctr	Intact	Metal	Gray	0.5
1307	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1308	A	Hatch	Lft		Intact	Metal	Gray	0
First Floor - Lobby								
1430	C	Wall	U Ctr		Intact	Wallpaper	White	0
1431	C	Railing	Ctr	Railing	Intact	Wood	Varnish	0.1
1432	C	Elev Door	Lft		Intact	Metal	Gray	0.3
1433	C	Elev Casing	Lft		Intact	Metal	Gray	0.1
1434	C	Elev Casing	Lft		Intact	Wood	Varnish	0.1
1435	C	Elev Casing	Ctr		Intact	Metal	Gray	0
1436	C	Door	Ctr	U Ctr	Intact	Metal	Gray	0
1437	D	Hatch	Lft		Intact	Metal	Gray	0
1438	C	Door	Rgt	Lft casing	Intact	Metal	Gray	0
1439	C	Door	Rgt	U Ctr	Intact	Wood	Varnish	0
1440	C	Crown Mldg	Rgt		Intact	Wood	Varnish	0.1
1441	D	Wall	L Rgt		Intact	Wood	Varnish	0.1
1442	D	Shelf	Rgt		Intact	Wood	Varnish	0
1443	D	Baseboard	Rgt		Intact	Wood	Varnish	0.1
1444	D	Cabinet	Rgt		Intact	Metal	Gray	0.2
1445	A	Heater Vent	Lft		Intact	Metal	Tan	0
1446	B	Shelf	Lft		Intact	Wood	Varnish	0.1
1447	B	Cabinet	Ctr		Intact	Metal	Gray	0
1448	B	Column	Ctr	L column	Intact	Wood	Varnish	0
1449	B	Column	Ctr	U column	Intact	Wallpaper	White	0.1
First Floor - Back Exit								
1450	A	Wall	U Ctr		Intact	Conc Blk	White	0.1
1451	B	Wall	U Ctr		Intact	Conc Blk	White	0
1452	C	Wall	U Ctr		Intact	Conc Blk	White	0
1453	D	Wall	U Ctr		Intact	Plaster	White	0.1
1454	A	Ceiling			Intact	Plaster	White	0.1
1455	D	Wall	U Rgt		Intact	Plaster	White	0
1456	A	Elev Casing	Rgt		Intact	Metal	Gray	0.1
1457	A	Elev Door	Rgt		Intact	Metal	Gray	0.3
1458	A	Closet	Ctr	Door Casing	Intact	Metal	Gray	0
1459	A	Closet	Ctr	Door	Intact	Metal	Gray	0
1460	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
1461	C	Door	Ctr	U Ctr	Intact	Metal	Gray	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
1462	C	Door	Rgt	Lft casing	Intact	Metal	Gray	0.2
1463	C	Door	Rgt	U Ctr	Intact	Metal	Gray	0
1464	D	Heater Vent	Rgt		Intact	Metal	Tan	0
1465	D	Column	Ctr	L column	Intact	Concrete	White	0.2
1466	A	Closet	Ctr	Wall	Intact	Conc Blk	White	0
1467	A	Closet	Ctr	Ceiling	Intact	Concrete	White	0.1
First Floor - Lobby Men's Restroom								
1468	A	Wall	U Ctr		Intact	Cer Tile	White	0.1
1469	B	Wall	U Ctr		Intact	Cer Tile	White	0.2
1470	C	Wall	U Ctr		Intact	Cer Tile	White	0
1471	D	Wall	U Ctr		Intact	Cer Tile	White	0
1472	A	Ceiling			Intact	Plaster	White	0.2
1473	B	Trim	Ctr		Intact	Wood	Varnish	0
1474	B	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1475	B	Door	Ctr	Lft casing	Intact	Metal	Gray	0
First Floor - Lobby Women's Restroom								
1476	A	Wall	U Ctr		Intact	Cer Tile	White	0.2
1477	B	Wall	U Ctr		Intact	Cer Tile	White	0.2
1478	C	Wall	U Ctr		Intact	Cer Tile	White	0.2
1479	D	Wall	U Ctr		Intact	Cer Tile	White	0
1480	A	Ceiling			Intact	Plaster	White	0
1481	D	Heater Vent	Ctr		Intact	Metal	White	0
1482	B	Trim	Ctr		Intact	Wood	Varnish	0
1483	B	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1484	B	Door	Ctr	Lft casing	Intact	Metal	Gray	0
First Floor - Vestibule								
1485	A	Wall	U Ctr		Intact	Conc Blk	White	0.1
1486	B	Wall	U Ctr		Intact	Plaster	White	0.1
1487	C	Wall	U Ctr		Intact	Plaster	White	0
1488	D	Wall	U Ctr		Intact	Plaster	White	0.1
1489	A	Door	Ctr	Lft casing	Intact	Metal	Black	0
1490	A	Door	Ctr	U Ctr	Intact	Metal	Black	0.1
1491	A	Window	Ctr	Lft casing	Intact	Metal	Black	0
1492	C	Window	Ctr	Lft casing	Intact	Metal	Black	0
1493	C	Door	Ctr	Lft casing	Intact	Metal	Black	0.1
1494	C	Door	Ctr	U Ctr	Intact	Metal	Black	0.1
1495	B	Heater Vent	Ctr		Intact	Metal	Gray	0
1496	B	Heater Vent	Ctr		Intact	Metal	White	0
First Floor - Sitting Room								
1497	A	Wall	L Ctr		Intact	Wood Pnl	Varnish	0
1498	B	Wall	L Ctr		Intact	Wood Pnl	Varnish	0.1
1499	C	Wall	L Ctr		Intact	Wood Pnl	Varnish	0.1
1500	D	Wall	L Ctr		Intact	Wood Pnl	Varnish	0
1501	A	Crown Mldg	Ctr		Intact	Wood Pnl	Varnish	0
1502	A	Window	Ctr	Lft casing	Intact	Metal	Black	0.1
1503	B	Wall	U Ctr		Intact	Wallpaper	White	0
1504	B	Chair rail	Ctr		Intact	Wood	Varnish	0
1505	B	Baseboard	Ctr		Intact	Wood	Varnish	0
1506	A	Window	Ctr	Sill	Intact	Wood	Varnish	0
1507	A	Heater Vent	Ctr		Intact	Metal	Tan	0
1508	C	Column	Ctr	L column	Intact	Wood	Varnish	0.2

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
1509	C	Column	Ctr	U column	Intact	Wallpaper	White	0
1510	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1511	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
First Floor - Dining Room								
1512	A	Wall	U Ctr		Intact	Drywall	White	0.2
1513	B	Wall	U Ctr		Intact	Drywall	White	0.1
1514	C	Wall	U Ctr		Intact	Drywall	White	0
1515	D	Wall	U Ctr		Intact	Drywall	White	0.1
1516	A	Wall	L Ctr		Intact	Wood Pnl	Varnish	0
1517	B	Wall	L Ctr		Intact	Wood Pnl	Varnish	0
1518	C	Wall	L Ctr		Intact	Wood Pnl	Varnish	0.1
1519	D	Wall	L Ctr		Intact	Wood Pnl	Varnish	0
1520	A	Chair rail	Ctr		Intact	Wood Pnl	Varnish	0
1521	A	Baseboard	Ctr		Intact	Wood Pnl	Varnish	0.1
1522	A	Cabinet	Rgt		Intact	Wood Pnl	Varnish	0
1523	C	Window	Ctr	Sill	Intact	Wood Pnl	Varnish	0
1524	C	Window	Ctr	Lft casing	Intact	Metal	Black	0.2
1525	C	Door	Lft	Lft casing	Intact	Metal	Black	0
1526	C	Door	Lft	U Ctr	Intact	Metal	Black	0.1
1527	C	Door	Rgt	U Ctr	Intact	Metal	Black	0.2
1528	C	Door	Rgt	Lft casing	Intact	Metal	Black	0
1529	D	Door	Lft	Lft casing	Intact	Metal	Gray	0
1530	D	Door	Rgt	Lft casing	Intact	Metal	Gray	0
1531	D	Door	Lft	U Ctr	Intact	Wood	Varnish	0
1532	D	Door	Rgt	U Ctr	Intact	Wood	Varnish	0
1533	C	Crown Mldg	Ctr		Intact	Wood	Varnish	0
1534	C	Heater Vent	Ctr		Intact	Metal	Gray	0
1535	D	Shelf	Lft		Intact	Metal	White	0
1536	D	Shelf	Rgt		Intact	Metal	White	0.1
First Floor - Electrical Room								
1540	B	Wall	U Ctr		Intact	Plaster	Tan	0
1541	C	Wall	U Ctr		Intact	Plaster	Tan	0
1542	A	Elec Panel	Lft		Intact	Metal	Gray	0.1
1543	A	Elec Panel	Rgt		Intact	Metal	Gray	0.1
1544	A	Base	Lft		Intact	Concrete	Red	0.1
1545	A	Floor			Intact	Concrete	Gray	0.2
1546	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
1547	D	Door	Ctr	U Ctr	Intact	Metal	Gray	0.4
1548	A	Elec Panel	Rgt		Intact	Metal	Green	0
1549	C	Elec Panel	Lft		Intact	Metal	Gray	0.1
1550	C	Elec Panel	Rgt		Intact	Metal	Gray	0
1551	C	Elec Panel	Ctr		Intact	Metal	Red	0.1
1552	C	Elec Panel	Rgt		Intact	Metal	Red	0.1
1553	C	Elec Panel	Rgt		Intact	Metal	Tan	0
First Floor - Elevator Room								
1554	A	Wall	U Ctr		Intact	Conc Blk	Tan	0
1555	B	Wall	U Ctr		Intact	Concrete	Tan	0
1556	C	Wall	U Ctr		Intact	Conc Blk	Tan	0
1557	D	Wall	U Ctr		Intact	Conc Blk	Tan	0
1558	A	Wall	U Rgt		Intact	Concrete	Tan	0
1559	A	Ceiling			Intact	Concrete	Tan	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
1560	A	Floor			Intact	Concrete	Gray	0.2
1561	A	Door	Ctr	U Ctr	Intact	Metal	Gray	0.1
1562	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1563	A	Elev Eqpt	Rgt		Intact	Metal	Black	0
1564	A	Elev Eqpt	Rgt		Intact	Metal	Green	0.1
1565	C	Elev Eqpt	Rgt		Intact	Metal	Green	0.1
1566	C	Elev Eqpt	Rgt		Intact	Metal	Black	0
1567	B	Pipe	Ctr		Intact	Metal	Green	0.5
1568	B	Pipe	Ctr		Intact	Metal	Black	0.1
1569	B	Pipe	Ctr		Intact	Metal	Red	0
1570	D	Elec Panel	Ctr		Intact	Metal	Gray	0
1571	C	Cabinet	Ctr		Intact	Metal	Gray	0
1572	C	Vent	Ctr		Intact	Metal	Tan	0
1573	A	Ceiling			Intact	Drywall	Tan	0.1
Second Floor - Hallway								
1574	A	Wall	U Ctr		Intact	Drywall	Tan	0
1575	B	Wall	U Ctr		Intact	Drywall	Tan	0
1576	C	Wall	U Ctr		Intact	Drywall	Tan	0
1577	D	Wall	U Ctr		Intact	Drywall	Tan	0
1578	A	Closet	Ctr	Door	Intact	Wood	Varnish	0
1579	A	Closet	Ctr	Door Casing	Intact	Metal	Gray	0
1580	C	Heater Vent	Ctr		Intact	Metal	Gray	0
1581	C	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
1582	C	Window	Ctr	Sash	Intact	Wood	Varnish	0
1583	A	Cabinet	Ctr		Intact	Wood	Green	0
1592	B	Wall	U Ctr		Intact	Wallpaper	White	0
1593	B	Heater Vent	Ctr		Intact	Metal	Gray	0
1594	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
1595	A	Window	Ctr	Sash	Intact	Wood	Varnish	0
1596	B	Vent	Lft		Intact	Metal	Gray	0.2
1597	B	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1598	B	Door	Ctr	U Ctr	Intact	Metal	Gray	0.6
1599	C	Railing	Ctr	Railing	Intact	Wood	Varnish	0
1600	C	Elev Door	Ctr		Intact	Metal	Gray	0.1
1601	C	Elev Casing	Ctr		Intact	Metal	Gray	0.2
1602	D	Cabinet	Lft		Intact	Wood	Varnish	0
1603	C	Cabinet	Rgt		Intact	Metal	Gray	0
1604	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0.2
1605	D	Door	Ctr	U Ctr	Intact	Metal	Gray	0
1606	B	Ceiling			Intact	Drywall	White	0
1607	D	Ceiling			Intact	Drywall	White	0
1608	C	Ceiling			Intact	Drywall	White	0
Second Floor - Laundry Room								
1609	A	Ceiling			Intact	Drywall	White	0.3
1610	A	Wall	U Ctr		Intact	Wallpaper	White	0
1611	A	Heater Vent	Ctr		Intact	Metal	Gray	0
1612	A	Window	Ctr	Sash	Intact	Wood	Varnish	0
1613	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
1614	B	Elec Panel	Ctr		Intact	Metal	Gray	0
1615	B	Trim	Ctr		Intact	Metal	White	0
1616	D	Vent	Ctr		Intact	Metal	White	0.1

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
1617	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1618	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1619	A	Horiz Beam	Ctr		Intact	Concrete	White	0.1
1620	C	Shelf	Ctr		Intact	Wood	Varnish	0.1
Third Floor - Hallway								
1621	A	Wall	U Ctr		Intact	Wallpaper	White	0
1622	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
1623	A	Window	Ctr	Sash	Intact	Wood	Varnish	0
1624	A	Heater Vent	Ctr		Intact	Metal	Gray	0.1
1625	A	Horiz Beam	Ctr		Intact	Concrete	White	0.1
1626	A	Ceiling			Intact	Drywall	White	0.2
1627	B	Door	Ctr	Lft casing	Intact	Metal	Gray	0.6
1628	B	Door	Ctr	U Ctr	Intact	Metal	Gray	0
1629	C	Railing	Ctr	Railing	Intact	Wood	Varnish	0
1630	B	Ceiling			Intact	Drywall	White	0.2
1631	C	Elev Casing	Ctr		Intact	Metal	Gray	0.4
1632	C	Elev Door	Ctr		Intact	Metal	Gray	0
1633	D	Cabinet	Lft		Intact	Wood	Varnish	0
1634	C	Cabinet	Rgt		Intact	Metal	Gray	0.1
1635	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0.5
1636	D	Door	Ctr	U Ctr	Intact	Metal	Gray	0.6
1637	D	Ceiling			Intact	Drywall	White	0.3
Fourth Floor - Hallway								
1638	A	Ceiling			Intact	Drywall	White	0.1
1639	A	Horiz Beam	Ctr		Intact	Concrete	White	0.1
1640	A	Heater Vent	Ctr		Intact	Metal	Gray	0
1641	A	Wall	U Ctr		Intact	Wallpaper	White	0
1642	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
1643	A	Window	Ctr	Sash	Intact	Wood	Varnish	0
1644	A	Railing	Ctr	Railing	Intact	Wood	Varnish	0
1645	B	Vent	Lft		Intact	Metal	White	0.2
1646	B	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1647	B	Door	Ctr	U Ctr	Intact	Metal	Gray	0.1
1648	B	Ceiling			Intact	Drywall	White	0.3
1649	C	Elev Door	Ctr		Intact	Metal	Gray	0.1
1650	C	Elev Casing	Ctr		Intact	Metal	Gray	0
1651	C	Cabinet	Rgt		Intact	Metal	Gray	0
1652	D	Cabinet	Lft		Intact	Wood	Varnish	0
1653	D	Door	Ctr	U Ctr	Intact	Metal	Gray	0.6
1654	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1655	A	Ceiling			Intact	Drywall	White	0.3
Fourth Floor - Laundry Room								
1656	A	Ceiling			Intact	Drywall	White	0.3
1657	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0.1
1658	A	Window	Ctr	Sash	Intact	Wood	Varnish	0
1659	A	Horiz Beam	Ctr		Intact	Concrete	White	0
1660	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1661	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1662	A	Heater Vent	Ctr		Intact	Metal	Gray	0
1663	B	Trim	Ctr		Intact	Metal	White	0
1664	D	Vent	Ctr		Intact	Metal	White	0.1

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
1665	B	Shelf	Ctr		Intact	Wood	Varnish	0
1666	C	Shelf	Ctr		Intact	Wood	Varnish	0.1
1667	C	Wall	U Ctr		Intact	Wallpaper	White	0
Fifth Floor - Hallway								
1668	D	Wall	U Ctr		Intact	Wallpaper	White	0
1669	A	Heater Vent	Ctr		Intact	Metal	Gray	0
1670	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
1671	A	Window	Ctr	Sash	Intact	Wood	Varnish	0
1672	A	Horiz Beam	Ctr		Intact	Concrete	White	0.1
1673	A	Ceiling			Intact	Concrete	White	0.2
1674	B	Ceiling			Intact	Concrete	White	0.1
1675	C	Railing	Ctr	Railing	Intact	Wood	Varnish	0
1676	B	Door	Ctr	U Ctr	Intact	Metal	Gray	0
1677	B	Door	Ctr	Lft casing	Intact	Metal	Gray	0.6
1678	C	Elev Door	Ctr		Intact	Metal	Gray	0.1
1679	C	Elev Casing	Ctr		Intact	Metal	Gray	0.1
1680	C	Cabinet	Rgt		Intact	Metal	Gray	0.1
1681	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0.5
1682	D	Door	Ctr	U Ctr	Intact	Metal	Gray	0.1
1683	D	Ceiling			Intact	Drywall	White	0.2
Sixth Floor - Hallway								
1684	A	Ceiling			Intact	Drywall	White	0
1685	A	Horiz Beam	Ctr		Intact	Concrete	White	0
1686	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
1687	A	Window	Ctr	Sash	Intact	Wood	Varnish	0
1688	C	Wall	U Ctr		Intact	Wallpaper	White	0.1
1689	A	Heater Vent	Ctr		Intact	Metal	Gray	0
1690	B	Vent	Lft		Intact	Metal	Gray	0.3
1691	C	Elev Door	Ctr		Intact	Metal	Gray	0
1692	C	Elev Casing	Ctr		Intact	Metal	Gray	0.2
1693	C	Railing	Ctr	Railing	Intact	Wood	Varnish	0
1694	B	Ceiling			Intact	Drywall	White	0.3
1695	B	Door	Ctr	U Ctr	Intact	Metal	Gray	0.5
1696	B	Door	Ctr	Lft casing	Intact	Metal	Gray	0.5
1697	D	Cabinet	Lft		Intact	Wood	Varnish	0
1698	C	Cabinet	Rgt		Intact	Metal	Gray	0
1699	D	Door	Ctr	U Ctr	Intact	Metal	Gray	0
1700	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
1701	D	Ceiling			Intact	Drywall	White	0.2
Sixth Floor - Laundry Room								
1702	A	Ceiling			Intact	Drywall	White	0
1703	A	Horiz Beam	Ctr		Intact	Concrete	White	0
1704	B	Wall	U Ctr		Intact	Wallpaper	White	0
1705	A	Heater Vent	Ctr		Intact	Metal	Gray	0
1706	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1707	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1708	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
1709	A	Window	Ctr	Sash	Intact	Wood	Varnish	0
1710	B	Trim	Ctr		Intact	Metal	White	0
1711	D	Vent	Ctr		Intact	Metal	White	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
Seventh Floor - Hallway								
1712	A	Wall	U Ctr		Intact	Wallpaper	White	0
1713	A	Ceiling			Intact	Drywall	White	0
1714	A	Horiz Beam	Ctr		Intact	Concrete	White	0
1715	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
1716	A	Window	Ctr	Sash	Intact	Wood	Varnish	0
1717	A	Railing	Ctr	Railing	Intact	Wood	Varnish	0
1718	A	Heater Vent	Ctr		Intact	Metal	Gray	0
1719	C	Elev Door	Ctr		Intact	Metal	Gray	0
1720	C	Elev Casing	Ctr		Intact	Metal	Gray	0.2
1721	B	Ceiling			Intact	Drywall	White	0.2
1722	B	Door	Ctr	U Ctr	Intact	Metal	Gray	0.4
1723	B	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1724	C	Cabinet	Rgt		Intact	Metal	Gray	0
1725	D	Cabinet	Lft		Intact	Wood	Varnish	0
1726	D	Door	Ctr	U Ctr	Intact	Metal	Gray	0.6
1727	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0.5
1728	D	Ceiling			Intact	Drywall	White	0.1
East Stairwell								
1729	A	Wall	U Ctr		Intact	Concrete	White	0.1
1730	B	Wall	U Ctr		Intact	Concrete	White	0.2
1731	C	Wall	U Ctr		Intact	Concrete	White	0.1
1732	D	Wall	U Ctr		Intact	Concrete	White	0.1
1733	A	Ceiling			Intact	Concrete	White	0.1
1734	B	Wall	U Ctr		Intact	Conc Blk	White	0.1
1735	C	Wall	U Ctr		Intact	Conc Blk	White	0
1736	A	Heater Vent	Ctr		Intact	Metal	Gray	0.1
1737	B	Cabinet	Ctr		Intact	Metal	Red	0
1738	C	Railing	Ctr	Railing	Intact	Metal	Gray	0.1
1739	D	Ladder	Ctr		Intact	Metal	Gray	0.1
1740	D	Roof Hatch	Ctr		Intact	Metal	Gray	0
1741	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1742	C	Door	Ctr	U Ctr	Intact	Metal	Gray	0.1
West Stairwell								
1743	A	Wall	U Ctr		Intact	Concrete	White	0.1
1744	B	Wall	U Ctr		Intact	Concrete	White	0.1
1745	C	Wall	U Ctr		Intact	Concrete	White	0
1746	D	Wall	U Ctr		Intact	Concrete	White	0.1
1747	A	Ceiling			Intact	Concrete	White	0
1748	A	Wall	U Ctr		Intact	Conc Blk	White	0
1749	B	Wall	U Ctr		Intact	Conc Blk	White	0
1750	C	Heater Vent	Ctr		Intact	Metal	Gray	0.1
1751	D	Railing	Ctr	Railing	Intact	Metal	Gray	0.1
1752	D	Cabinet	Ctr		Intact	Metal	Red	0
1753	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1754	A	Door	Ctr	U Ctr	Intact	Metal	Gray	0
Maintenance Shed Interior								
Maintenance Shed West Room								
1189	A	Wall	U Ctr		Intact	Conc Blk	White	0
1190	B	Wall	U Ctr		Intact	Conc Blk	White	0
1191	C	Wall	U Ctr		Intact	Conc Blk	White	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
1192	D	Wall	U Ctr		Intact	Wood	White	0
1193	A	Ceiling			Intact	Drywall	White	0
1194	B	Door	Lft	U Ctr	Intact	Metal	Gray	0
1195	B	Door	Lft	Lft casing	Intact	Metal	Gray	0
1196	B	Trim	Ctr		Intact	Wood	White	0
1197	D	Shelf	Lft		Intact	Wood	White	0.1
1198	D	Shelf	Ctr		Intact	Wood	White	0
1199	D	Shelf	Rgt		Intact	Wood	White	0
1200	D	Horiz Beam	Ctr		Intact	Metal	White	0
Maintenance Shed Northeast Room								
1201	A	Wall	U Ctr		Intact	Wood	White	0
1202	B	Wall	U Ctr		Intact	Wood	White	0
1203	C	Wall	U Ctr		Intact	Conc Blk	White	0
1204	D	Wall	U Ctr		Intact	Conc Blk	White	0
1205	B	Door	Ctr	Lft casing	Intact	Metal	Black	0
1206	C	Shelf	Ctr		Intact	Wood	White	0
1207	A	Ceiling			Intact	Drywall	White	0
1208	A	Horiz Beam	Ctr		Intact	Metal	White	0
Maintenance Shed Southeast Room								
1209	A	Wall	U Ctr		Intact	Conc Blk	White	0
1210	D	Wall	U Ctr		Intact	Conc Blk	White	0
1211	B	Wall	U Ctr		Intact	Wood	White	0
1212	C	Wall	U Ctr		Intact	Wood	White	0
1213	C	Shelf	Ctr		Intact	Wood	White	0
1214	D	Shelf	Ctr		Intact	Wood	White	0
1215	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1216	A	Door	Ctr	U Ctr	Intact	Metal	Gray	0
1217	A	Ceiling			Intact	Drywall	White	0
Steven's Point Housing Authority Office Suite								
Lobby								
1309	A	Wall	U Ctr		Intact	Drywall	White	0
1310	B	Wall	U Ctr		Intact	Drywall	White	0
1311	C	Wall	U Ctr		Intact	Drywall	White	0
1312	D	Wall	U Ctr		Intact	Drywall	White	0
1313	A	Window	Ctr	Sill	Intact	Wood	Varnish	0.1
1314	B	Door	Ctr	U Ctr	Intact	Wood	Varnish	0.1
1315	B	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1316	B	Baseboard	Ctr		Intact	Wood	Varnish	0
1317	D	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1318	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
Reception								
1319	A	Wall	U Ctr		Intact	Drywall	Tan	0.1
1320	B	Wall	U Ctr		Intact	Drywall	Tan	0
1321	C	Wall	U Ctr		Intact	Drywall	Tan	0
1322	D	Wall	U Ctr		Intact	Drywall	Tan	0
1323	B	Baseboard	Ctr		Intact	Wood	Varnish	0.1
1324	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
Office 1								
1325	A	Wall	U Ctr		Intact	Drywall	Tan	0
1326	B	Wall	U Ctr		Intact	Drywall	Tan	0.1
1327	C	Wall	U Ctr		Intact	Drywall	Tan	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
1328	A	Window	Ctr	Sill	Intact	Wood	Varnish	0
1329	C	Baseboard	Ctr		Intact	Wood	Varnish	0
1330	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0.1
1331	C	Door	Ctr	Lft casing	Intact	Wood	Varnish	0
Copy Room								
1332	A	Wall	U Ctr		Intact	Drywall	White	0.1
1333	B	Wall	U Ctr		Intact	Drywall	White	0
1334	C	Wall	U Ctr		Intact	Drywall	White	0
1335	D	Wall	U Ctr		Intact	Drywall	White	0.1
1336	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1337	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1338	D	Baseboard	Ctr		Intact	Wood	Varnish	0
Office 3								
1339	A	Wall	U Ctr		Intact	Drywall	Tan	0
1340	B	Wall	U Ctr		Intact	Drywall	Tan	0.1
1341	C	Wall	U Ctr		Intact	Drywall	Tan	0
1342	D	Wall	U Ctr		Intact	Drywall	Tan	0
1343	A	Window	Ctr	Sill	Intact	Wood	Varnish	0.1
1344	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
1345	A	Heater Vent	Ctr		Intact	Metal	Tan	0
1346	C	Baseboard	Ctr		Intact	Wood	Varnish	0.1
1347	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1348	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
Server Room								
1349	A	Wall	U Ctr		Intact	Drywall	Tan	0
1350	B	Wall	U Ctr		Intact	Drywall	Tan	0.1
1351	C	Wall	U Ctr		Intact	Drywall	Tan	0
1352	A	Baseboard	Ctr		Intact	Wood	Varnish	0
1353	A	Baseboard	Ctr		Intact	Wood	Varnish	0.1
1354	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1355	A	Door	Ctr	Lft casing	Intact	Wood	Varnish	0
1356	D	Shelf	Ctr		Intact	Wood	Varnish	0.1
1357	D	Elec Box	Ctr		Intact	Metal	Black	0
1358	C	Elec Box	Ctr		Intact	Metal	Gray	0
1359	C	Elec Box	Ctr		Intact	Metal	Black	0
1360	C	Elec Box	Ctr		Intact	Metal	Black	0
Office 4								
1361	A	Wall	U Ctr		Intact	Drywall	Tan	0
1362	B	Wall	U Ctr		Intact	Drywall	Tan	0
1363	C	Wall	U Ctr		Intact	Drywall	Tan	0
1364	D	Wall	U Ctr		Intact	Drywall	Tan	0
1365	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0.1
1366	A	Window	Ctr	Sill	Intact	Wood	Varnish	0
1367	A	Heater Vent	Ctr		Intact	Metal	Tan	0
1368	C	Closet	Ctr	Door	Intact	Wood	Varnish	0
1369	C	Baseboard	Ctr		Intact	Wood	Varnish	0
1370	D	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1371	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1372	C	Closet	Ctr	Shelf	Intact	Metal	White	0
Office 5								
1373	A	Wall	U Ctr		Intact	Drywall	Tan	0.1

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
1374	B	Wall	U Ctr		Intact	Drywall	Tan	0
1375	C	Wall	U Ctr		Intact	Drywall	Tan	0
1376	D	Wall	U Ctr		Intact	Drywall	Tan	0
1377	A	Heater Vent	Ctr		Intact	Metal	Tan	0
1378	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
1379	A	Window	Ctr	Sill	Intact	Wood	Varnish	0
1380	B	Baseboard	Ctr		Intact	Wood	Varnish	0.1
1381	A	Floor			Intact	Wood	Varnish	0
1382	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1383	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
Office 6								
1384	A	Wall	U Ctr		Intact	Drywall	Tan	0
1385	B	Wall	U Ctr		Intact	Drywall	Tan	0.1
1386	C	Wall	U Ctr		Intact	Drywall	Tan	0
1387	D	Wall	U Ctr		Intact	Drywall	Tan	0
1388	A	Heater Vent	Ctr		Intact	Metal	Tan	0
1389	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
1390	A	Window	Ctr	Sash	Intact	Wood	Varnish	0
1391	C	Baseboard	Ctr		Intact	Wood	Varnish	0
1392	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1393	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
Bathroom								
1394	A	Wall	U Ctr		Intact	Drywall	White	0
1395	B	Wall	U Ctr		Intact	Drywall	White	0.1
1396	C	Wall	U Ctr		Intact	Drywall	White	0
1397	D	Wall	U Ctr		Intact	Drywall	White	0.1
1398	A	Baseboard	Ctr		Intact	Cer Tile	White	0.4
1399	D	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1400	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1401	D	Cabinet	Ctr		Intact	Wood	Varnish	0
Hallway								
1402	A	Wall	U Ctr		Intact	Drywall	White	0.1
1403	B	Wall	U Ctr		Intact	Drywall	White	0.1
1404	C	Wall	U Ctr		Intact	Drywall	White	0
1405	D	Wall	U Ctr		Intact	Drywall	White	0
1406	B	Elec Panel	Ctr		Intact	Metal	White	0
1407	A	Hatch	Lft		Intact	Metal	White	0
1408	A	Cabinet	Lft		Intact	Wood	Varnish	0
1409	C	Baseboard	Ctr		Intact	Wood	Varnish	0.1
1410	C	Cabinet	Ctr		Intact	Wood	Varnish	0
1411	D	Shelf	Lft		Intact	Wood	Varnish	0
1412	D	Elec Panel	Lft		Intact	Metal	White	0
1413	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1414	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1415	C	Door	Lft	U Ctr	Intact	Wood	Varnish	0.1
1416	C	Door	Lft	Lft casing	Intact	Metal	Gray	0
1417	C	Cabinet	Rgt		Intact	Metal	Gray	0
1418	C	Cabinet	Rgt		Intact	Metal	Blue	0
1419	D	Column	Rgt	L column	Intact	Concrete	White	0.1
Office 2								
1420	A	Wall	U Ctr		Intact	Drywall	Tan	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
1421	B	Wall	U Ctr		Intact	Drywall	Tan	0
1422	C	Wall	U Ctr		Intact	Drywall	Tan	0.1
1423	D	Wall	U Ctr		Intact	Drywall	Tan	0.1
1424	A	Heater Vent	Ctr		Intact	Metal	Gray	0
1425	C	Door	Lft	Lft casing	Intact	Metal	Gray	0
1426	C	Door	Lft	U Ctr	Intact	Wood	Varnish	0
1427	C	Door	Rgt	U Ctr	Intact	Wood	Varnish	0
1428	C	Door	Rgt	Lft casing	Intact	Metal	Gray	0
1429	C	Baseboard	Ctr		Intact	Wood	Varnish	0
Apartment 103								
Living Room								
24	A	Wall	U Ctr		Intact	Drywall	White	0
25	B	Wall	U Ctr		Intact	Drywall	White	0.1
26	C	Wall	U Ctr		Intact	Drywall	White	0.1
27	D	Wall	U Ctr		Intact	Drywall	White	0.2
28	A	Ceiling			Intact	Drywall	White	0
29	A	Window	Ctr	Sash	Intact	Wood	Varnish	0
30	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
31	C	Baseboard	Ctr		Intact	Wood	Varnish	0
32	C	Cabinet	Ctr		Intact	Wood	Varnish	0
Kitchen								
33	A	Wall	U Ctr		Intact	Drywall	White	0.1
34	B	Wall	U Ctr		Intact	Drywall	White	0.1
35	C	Wall	U Ctr		Intact	Drywall	White	0.1
36	D	Wall	U Ctr		Intact	Drywall	White	0
37	A	Ceiling			Intact	Drywall	White	0
38	A	Cabinet	Ctr		Intact	Wood	Varnish	0.1
39	B	Baseboard	Ctr		Intact	Wood	Varnish	0
40	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
41	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
42	C	Shelf	Lft		Intact	Metal	White	0
Bedroom								
43	A	Wall	U Ctr		Intact	Drywall	White	0.1
44	B	Wall	U Ctr		Intact	Drywall	White	0
45	C	Wall	U Ctr		Intact	Drywall	White	0
46	D	Wall	U Ctr		Intact	Drywall	White	0.1
47	A	Ceiling			Intact	Drywall	White	0
48	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
49	A	Window	Ctr	Sash	Intact	Wood	Varnish	0
50	A	Heater Vent	Ctr		Intact	Metal	White	0
51	B	Baseboard	Ctr		Intact	Wood	Varnish	0
52	C	Closet	Ctr	Door	Intact	Wood	Varnish	0.1
53	C	Closet	Ctr	Door Casing	Intact	Wood	Varnish	0
54	C	Closet	Ctr	Shelf	Intact	Metal	White	0
55	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
56	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
Bathroom								
57	A	Wall	U Ctr		Intact	Drywall	White	0
58	B	Wall	U Ctr		Intact	Drywall	White	0
59	C	Wall	U Ctr		Intact	Drywall	White	0
60	D	Wall	U Ctr		Intact	Drywall	White	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
61	A	Ceiling			Intact	Drywall	White	0.1
62	A	Heater Vent	Ctr		Intact	Metal	White	0
63	C	Wall	L Ctr		Intact	Cer Tile	White	0
64	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
65	D	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
Interior Room 006 Living Rm								
66	A	Wall	U Ctr		Intact	Drywall	White	0
67	B	Wall	U Ctr		Intact	Drywall	White	0.1
68	C	Wall	U Ctr		Intact	Drywall	White	0
69	D	Wall	U Ctr		Intact	Drywall	White	0.1
70	A	Ceiling			Intact	Drywall	White	0.2
71	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
72	A	Window	Ctr	Sash	Intact	Wood	Varnish	0
73	A	Heater Vent	Ctr		Intact	Metal	White	0
74	B	Baseboard	Ctr		Intact	Wood	Varnish	0
75	C	Cabinet	Ctr		Intact	Wood	Varnish	0
76	A	Horiz Beam	Ctr		Intact	Concrete	White	0.1
Apartment 202								
Kitchen								
77	A	Wall	U Ctr		Intact	Drywall	White	0
78	B	Wall	U Ctr		Intact	Drywall	White	0
79	C	Wall	U Ctr		Intact	Drywall	White	0.1
80	D	Wall	U Ctr		Intact	Drywall	White	0
81	A	Ceiling			Intact	Drywall	White	0
82	C	Cabinet	Ctr		Intact	Wood	Varnish	0.1
83	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0.1
84	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
85	C	Baseboard	Ctr		Intact	Wood	Varnish	0
86	C	Shelf	Ctr		Intact	Metal	White	0
Bedroom								
87	A	Wall	U Ctr		Intact	Drywall	White	0
88	B	Wall	U Ctr		Intact	Drywall	White	0
89	C	Wall	U Ctr		Intact	Drywall	White	0.1
90	D	Wall	U Ctr		Intact	Drywall	White	0.1
91	A	Ceiling			Intact	Drywall	White	0
92	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0.1
93	A	Window	Ctr	Sash	Intact	Wood	Varnish	0
94	A	Heater Vent	Ctr		Intact	Metal	White	0
95	B	Baseboard	Ctr		Intact	Wood	Varnish	0
96	C	Closet	Ctr	Door Casing	Intact	Wood	Varnish	0.1
97	C	Closet	Ctr	Door	Intact	Wood	Varnish	0
98	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
99	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
100	C	Closet	Ctr	Shelf	Intact	Metal	White	0
101	A	Horiz Beam	Ctr		Intact	Concrete	White	0
Bathroom								
102	A	Wall	U Ctr		Intact	Drywall	White	0.1
103	B	Wall	U Ctr		Intact	Drywall	White	0.1
104	C	Wall	U Ctr		Intact	Drywall	White	0
105	D	Wall	U Ctr		Intact	Drywall	White	0
106	A	Ceiling			Intact	Drywall	White	0.1

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
107	B	Door	Ctr	Lft casing	Intact	Metal	Gray	0
108	B	Door	Ctr	U Ctr	Intact	Wood	Varnish	0.1
109	B	Wall	L Ctr		Intact	Cer Tile	White	0.1
Apartment 204								
Bathroom								
110	A	Wall	U Ctr		Intact	Drywall	White	0.1
111	B	Wall	U Ctr		Intact	Drywall	White	0.1
112	C	Wall	U Ctr		Intact	Drywall	White	0
113	D	Wall	U Ctr		Intact	Drywall	White	0.1
114	A	Ceiling			Intact	Drywall	White	0
115	A	Wall	L Ctr		Intact	Cer Tile	White	0.2
116	B	Heater Vent	Ctr		Intact	Metal	White	0
117	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
118	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
Bedroom								
119	A	Closet	Ctr	Shelf	Intact	Metal	White	0
120	B	Heater Vent	Ctr		Intact	Metal	White	0
121	A	Wall	U Ctr		Intact	Drywall	White	0
122	B	Wall	U Ctr		Intact	Drywall	White	0.1
123	C	Wall	U Ctr		Intact	Drywall	White	0
124	D	Wall	U Ctr		Intact	Drywall	White	0.1
125	A	Ceiling			Intact	Drywall	White	0.1
126	C	Horiz Beam	Ctr		Intact	Concrete	White	0
127	D	Baseboard	Ctr		Intact	Wood	Varnish	0
128	D	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
129	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0
130	C	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
131	C	Window	Ctr	Sash	Intact	Wood	Varnish	0
Kitchen								
132	A	Wall	U Ctr		Intact	Drywall	White	0
133	B	Wall	U Ctr		Intact	Drywall	White	0
134	D	Wall	U Ctr		Intact	Drywall	White	0
135	A	Ceiling			Intact	Drywall	White	0.3
136	B	Cabinet	Ctr		Intact	Wood	Varnish	0.1
Living Room								
137	A	Wall	U Ctr		Intact	Drywall	White	0
138	B	Wall	U Ctr		Intact	Drywall	White	0
139	C	Wall	U Ctr		Intact	Drywall	White	0
140	D	Wall	U Ctr		Intact	Drywall	White	0.1
141	A	Ceiling			Intact	Drywall	White	0.1
142	C	Horiz Beam	Ctr		Intact	Concrete	White	0
143	C	Heater Vent	Ctr		Intact	Metal	White	0
144	C	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
145	C	Window	Ctr	Sash	Intact	Wood	Varnish	0
146	D	Baseboard	Ctr		Intact	Wood	Varnish	0
147	B	Closet	Lft	Door Casing	Intact	Wood	Varnish	0
148	B	Closet	Lft	Shelf	Intact	Metal	White	0
149	B	Closet	Lft	Door	Intact	Wood	Varnish	0
150	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
151	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
Apartment 212								
Bathroom								
152	A	Wall	U Ctr		Intact	Drywall	White	0.1
153	B	Wall	U Ctr		Intact	Drywall	White	0
154	C	Wall	U Ctr		Intact	Drywall	White	0
155	D	Wall	U Ctr		Intact	Drywall	White	0
156	A	Ceiling			Intact	Drywall	White	0.1
157	D	Heater Vent	Ctr		Intact	Metal	White	0.1
158	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
159	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
160	B	Cabinet	Ctr		Intact	Wood	Varnish	0
Bedroom								
161	A	Wall	U Ctr		Intact	Drywall	White	0
162	B	Wall	U Ctr		Intact	Drywall	White	0
163	C	Wall	U Ctr		Intact	Drywall	White	0.1
164	D	Wall	U Ctr		Intact	Drywall	White	0.2
165	A	Ceiling			Intact	Drywall	White	0.2
166	A	Horiz Beam	Ctr		Intact	Concrete	White	0
167	A	Heater Vent	Ctr		Intact	Metal	White	0
168	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
169	A	Window	Ctr	Sash	Intact	Wood	Varnish	0
170	B	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
171	B	Door	Ctr	Lft casing	Intact	Metal	Gray	0
172	B	Baseboard	Ctr		Intact	Wood	Varnish	0.1
173	C	Closet	Ctr	Shelf	Intact	Metal	White	0.1
Kitchen								
174	B	Wall	U Ctr		Intact	Drywall	White	0.1
175	C	Wall	U Ctr		Intact	Drywall	White	0.1
176	D	Wall	U Ctr		Intact	Drywall	White	0
177	A	Ceiling			Intact	Drywall	White	0
178	B	Cabinet	Ctr		Intact	Wood	Varnish	0.3
Living Room								
179	A	Wall	U Ctr		Intact	Drywall	White	0.2
180	B	Wall	U Ctr		Intact	Drywall	White	0
181	C	Wall	U Ctr		Intact	Drywall	White	0
182	D	Wall	U Ctr		Intact	Drywall	White	0.1
183	A	Ceiling			Intact	Drywall	White	0
184	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0.1
185	A	Window	Ctr	Sash	Intact	Wood	Varnish	0
186	B	Baseboard	Ctr		Intact	Wood	Varnish	0
187	A	Heater Vent	Ctr		Intact	Metal	White	0
188	D	Closet	Ctr	Door Casing	Intact	Wood	Varnish	0
189	D	Closet	Ctr	Door	Intact	Wood	Varnish	0
190	D	Closet	Ctr	Shelf	Intact	Metal	White	0
191	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0.1
192	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
193	A	Horiz Beam	Ctr		Intact	Concrete	White	0
Apartment 216								
Bedroom Closet								
194	A	Wall	U Ctr		Intact	Drywall	White	0
195	B	Wall	U Ctr		Intact	Drywall	White	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
196	C	Wall	U Ctr		Intact	Drywall	White	0.1
197	D	Wall	U Ctr		Intact	Drywall	White	0.1
198	A	Ceiling			Intact	Drywall	White	0
199	A	Door	Ctr	Lft casing	Intact	Wood	Varnish	0
200	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
201	B	Cabinet	Ctr		Intact	Wood	Varnish	0.1
202	B	Baseboard	Ctr		Intact	Wood	Varnish	0.1
203	B	Trim	Ctr		Intact	Metal	White	0
204	C	Shelf	Ctr		Intact	Metal	White	0.1
Bedroom								
205	A	Wall	U Ctr		Intact	Drywall	White	0.1
206	B	Wall	U Ctr		Intact	Drywall	White	0.1
207	C	Wall	U Ctr		Intact	Drywall	White	0.1
208	D	Wall	U Ctr		Intact	Drywall	White	0.1
209	A	Ceiling			Intact	Drywall	White	0
210	A	Heater Vent	Ctr		Intact	Metal	White	0
211	A	Window	Lft	Lft casing	Intact	Wood	Varnish	0
212	A	Window	Lft	Sash	Intact	Wood	Varnish	0
213	A	Window	Rgt	Sash	Intact	Wood	Varnish	0
214	A	Window	Rgt	Lft casing	Intact	Wood	Varnish	0
215	A	Horiz Beam	Ctr		Intact	Concrete	White	0
216	B	Baseboard	Ctr		Intact	Wood	Varnish	0
217	B	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
218	B	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
219	A	Floor			Intact	Wood	Varnish	0.1
Bathroom								
220	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
221	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0
222	A	Wall	U Ctr		Intact	Drywall	White	0.1
223	B	Wall	U Ctr		Intact	Drywall	White	0
224	C	Wall	U Ctr		Intact	Drywall	White	0
225	D	Wall	U Ctr		Intact	Drywall	White	0
226	A	Ceiling			Intact	Drywall	White	0
227	C	Shelf	Ctr		Intact	Wood	Varnish	0
228	D	Cabinet	Ctr		Intact	Wood	Varnish	0
229	D	Trim	Ctr		Intact	Wood	White	0.1
Kitchen								
230	B	Wall	U Ctr		Intact	Drywall	White	0.1
231	C	Wall	U Ctr		Intact	Drywall	White	0.2
232	D	Wall	U Ctr		Intact	Drywall	White	0.1
233	A	Ceiling			Intact	Drywall	White	0
234	C	Cabinet	Ctr		Intact	Wood	Varnish	0
Living Room								
235	A	Wall	U Ctr		Intact	Drywall	White	0
236	B	Wall	U Ctr		Intact	Drywall	White	0
237	C	Wall	U Ctr		Intact	Drywall	White	0
238	D	Wall	U Ctr		Intact	Drywall	White	0
239	A	Ceiling			Intact	Drywall	White	0
240	A	Horiz Beam	Ctr		Intact	Concrete	White	0
241	A	Window	Lft	Lft casing	Intact	Wood	Varnish	0
242	A	Window	Lft	Sash	Intact	Wood	Varnish	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
243	A	Window	Rgt	Sash	Intact	Wood	Varnish	0
244	A	Window	Rgt	Lft casing	Intact	Wood	Varnish	0
245	A	Heater Vent	Ctr		Intact	Metal	White	0
246	C	Baseboard	Ctr		Intact	Wood	Varnish	0.1
247	B	Closet	Rgt	Door Casing	Intact	Wood	Varnish	0.1
248	B	Closet	Rgt	Door	Intact	Wood	Varnish	0
249	B	Closet	Rgt	Shelf	Intact	Wood	White	0.1
250	D	Closet	Lft	Shelf	Intact	Metal	White	0.1
251	D	Closet	Lft	Door Casing	Intact	Wood	Varnish	0
252	D	Closet	Lft	Door	Intact	Wood	Varnish	0
253	C	Door	Lft	U Ctr	Intact	Wood	Varnish	0
254	C	Door	Lft	Lft casing	Intact	Wood	Varnish	0
Apartment 303								
Bedroom								
255	A	Wall	U Ctr		Intact	Drywall	White	0
256	B	Wall	U Ctr		Intact	Drywall	White	0
257	C	Wall	U Ctr		Intact	Drywall	White	0
258	D	Wall	U Ctr		Intact	Drywall	White	0.1
259	A	Ceiling			Intact	Drywall	White	0
260	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
261	A	Window	Ctr	Sash	Intact	Wood	Varnish	0
262	A	Horiz Beam	Ctr		Intact	Concrete	White	0
263	A	Heater Vent	Ctr		Intact	Metal	White	0
264	C	Closet	Ctr	Door Casing	Intact	Wood	Varnish	0
265	C	Closet	Ctr	Door	Intact	Wood	Varnish	0
266	C	Closet	Ctr	Shelf	Intact	Metal	White	0
267	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
268	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
269	C	Baseboard	Ctr		Intact	Wood	Varnish	0
Bathroom								
270	A	Wall	U Ctr		Intact	Drywall	White	0
271	B	Wall	U Ctr		Intact	Drywall	White	0.1
272	C	Wall	U Ctr		Intact	Drywall	White	0
273	D	Wall	U Ctr		Intact	Drywall	White	0
274	A	Ceiling			Intact	Drywall	White	0
275	A	Heater Vent	Ctr		Intact	Metal	White	0
276	B	Trim	Ctr		Intact	Metal	White	0
277	B	Cabinet	Ctr		Intact	Wood	Varnish	0
278	C	Wall	L Ctr		Intact	Cer Tile	White	0
279	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0
280	D	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
Living Room								
281	A	Wall	U Ctr		Intact	Drywall	White	0
282	B	Wall	U Ctr		Intact	Drywall	White	0
283	C	Wall	U Ctr		Intact	Drywall	White	0
284	D	Wall	U Ctr		Intact	Drywall	White	0
285	A	Ceiling			Intact	Drywall	White	0.3
286	A	Heater Vent	Ctr		Intact	Metal	White	0.1
287	A	Horiz Beam	Ctr		Intact	Concrete	White	0
288	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
289	A	Window	Ctr	Sill	Intact	Wood	Varnish	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
290	B	Baseboard	Ctr		Intact	Wood	Varnish	0.1
291	C	Cabinet	Ctr		Intact	Wood	Varnish	0
Kitchen								
292	A	Wall	U Ctr		Intact	Drywall	White	0
293	B	Wall	U Ctr		Intact	Drywall	White	0
294	C	Wall	U Ctr		Intact	Drywall	White	0.1
295	D	Wall	U Ctr		Intact	Drywall	White	0
296	A	Ceiling			Intact	Drywall	White	0
297	A	Cabinet	Ctr		Intact	Wood	Varnish	0
298	C	Shelf	Lft		Intact	Metal	White	0
299	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
300	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
Apartment 310								
Bedroom								
301	A	Wall	U Ctr		Intact	Drywall	White	0
302	B	Wall	U Ctr		Intact	Drywall	White	0
303	C	Wall	U Ctr		Intact	Drywall	White	0.1
304	D	Wall	U Ctr		Intact	Drywall	White	0
305	A	Ceiling			Intact	Drywall	White	0
306	B	Baseboard	Ctr		Intact	Wood	Varnish	0
307	C	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
308	C	Window	Ctr	Sash	Intact	Wood	Varnish	0.1
309	C	Horiz Beam	Ctr		Intact	Concrete	White	0
310	C	Heater Vent	Ctr		Intact	Metal	White	0.1
311	A	Closet	Rgt	Shelf	Intact	Metal	White	0
312	A	Closet	Rgt	Door Casing	Intact	Wood	Varnish	0
313	A	Closet	Rgt	Door	Intact	Wood	Varnish	0
314	A	Door	Lft	U Ctr	Intact	Wood	Varnish	0
315	A	Door	Lft	Lft casing	Intact	Metal	Gray	0.1
Bathroom								
316	A	Wall	U Ctr		Intact	Drywall	White	0
317	B	Wall	U Ctr		Intact	Drywall	White	0
318	C	Wall	U Ctr		Intact	Drywall	White	0
319	D	Wall	U Ctr		Intact	Drywall	White	0
320	A	Ceiling			Intact	Drywall	White	0
321	B	Cabinet	Ctr		Intact	Wood	Varnish	0
322	D	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
323	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0
Living Room								
324	A	Wall	U Ctr		Intact	Drywall	White	0.1
325	B	Wall	U Ctr		Intact	Drywall	White	0
326	C	Wall	U Ctr		Intact	Drywall	White	0
327	D	Wall	U Ctr		Intact	Drywall	White	0.1
328	A	Ceiling			Intact	Drywall	White	0
329	C	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
330	C	Window	Ctr	Sash	Intact	Wood	Varnish	0
331	C	Heater Vent	Ctr		Intact	Metal	White	0
332	C	Horiz Beam	Ctr		Intact	Concrete	White	0.1
Kitchen								
333	A	Wall	U Ctr		Intact	Drywall	White	0
334	B	Wall	U Ctr		Intact	Drywall	White	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
335	C	Wall	U Ctr		Intact	Drywall	White	0
336	D	Wall	U Ctr		Intact	Drywall	White	0
337	A	Ceiling			Intact	Drywall	White	0
338	A	Cabinet	Ctr		Intact	Wood	Varnish	0.1
339	B	Baseboard	Ctr		Intact	Wood	Varnish	0
340	B	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
341	B	Door	Ctr	Lft casing	Intact	Wood	Varnish	0
Apartment 312								
Bedroom								
342	B	Wall	U Ctr		Intact	Drywall	White	0
343	C	Wall	U Ctr		Intact	Drywall	White	0
344	D	Wall	U Ctr		Intact	Drywall	White	0
345	A	Ceiling			Intact	Drywall	White	0.1
346	D	Heater Vent	Ctr		Intact	Metal	White	0
347	B	Heater Vent	Ctr		Intact	Metal	White	0
357	B	Door	Ctr	Lft casing	Intact	Metal	Gray	0
358	B	Door	Ctr	U Ctr	Intact	Wood	Varnish	0.1
Bathroom								
348	A	Wall	U Ctr		Intact	Drywall	White	0
349	B	Wall	U Ctr		Intact	Drywall	White	0
350	C	Wall	U Ctr		Intact	Drywall	White	0
351	D	Wall	U Ctr		Intact	Drywall	White	0.1
352	A	Ceiling			Intact	Drywall	White	0
353	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0
354	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
355	B	Cabinet	Ctr		Intact	Wood	Gray	0
356	D	Heater Vent	Ctr		Intact	Metal	White	0
Kitchen								
359	B	Wall	U Ctr		Intact	Drywall	White	0.1
360	C	Wall	U Ctr		Intact	Drywall	White	0.1
361	D	Wall	U Ctr		Intact	Drywall	White	0
362	A	Ceiling			Intact	Drywall	White	0.1
363	D	Cabinet	Ctr		Intact	Wood	Gray	0.1
364	B	Baseboard	Ctr		Intact	Wood	Varnish	0.1
Living Room								
365	A	Wall	U Ctr		Intact	Drywall	White	0.1
366	B	Wall	U Ctr		Intact	Drywall	White	0.1
367	C	Wall	U Ctr		Intact	Drywall	White	0.1
368	D	Wall	U Ctr		Intact	Drywall	White	0
369	A	Ceiling			Intact	Drywall	White	0.1
370	A	Heater Vent	Ctr		Intact	Metal	White	0.1
371	A	Horiz Beam	Ctr		Intact	Concrete	White	0
372	A	Window	Ctr	Lft casing	Intact	Metal	Tan	0
373	A	Window	Ctr	Sash	Intact	Metal	Tan	0
374	B	Baseboard	Ctr		Intact	Wood	Varnish	0.1
375	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
376	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
377	D	Closet	Ctr	Door Casing	Intact	Wood	Varnish	0
378	D	Closet	Ctr	Door	Intact	Wood	Varnish	0
379	D	Closet	Ctr	Shelf	Intact	Metal	White	0
380	D	Trim	Lft		Intact	Metal	White	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
Apartment 403								
Bedroom								
385	A	Wall	U Ctr		Intact	Drywall	White	0
386	B	Wall	U Ctr		Intact	Drywall	White	0
387	C	Wall	U Ctr		Intact	Drywall	White	0
388	D	Wall	U Ctr		Intact	Drywall	White	0
389	A	Ceiling			Intact	Drywall	White	0
390	A	Heater Vent	Ctr		Intact	Metal	White	0.2
391	A	Horiz Beam	Ctr		Intact	Concrete	White	0.2
392	C	Baseboard	Ctr		Intact	Wood	Varnish	0.2
393	C	Closet	Ctr	Door	Intact	Wood	Varnish	0
394	C	Closet	Ctr	Door Casing	Intact	Wood	Varnish	0.1
395	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
396	C	Closet	Ctr	Shelf	Intact	Metal	White	0
397	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
398	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
399	A	Window	Ctr	Sash	Intact	Wood	Varnish	0
Bathroom								
400	A	Heater Vent	Ctr		Intact	Metal	White	0
401	A	Wall	U Ctr		Intact	Drywall	White	0
402	B	Wall	U Ctr		Intact	Drywall	White	0
403	C	Wall	U Ctr		Intact	Drywall	White	0
404	D	Wall	U Ctr		Intact	Drywall	White	0
405	A	Ceiling			Intact	Drywall	White	0
406	B	Trim	Ctr		Intact	Metal	White	0
407	B	Cabinet	Ctr		Intact	Wood	Varnish	0
408	D	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
409	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
Living Room								
410	A	Wall	U Ctr		Intact	Drywall	White	0
411	B	Wall	U Ctr		Intact	Drywall	White	0
412	C	Wall	U Ctr		Intact	Drywall	White	0
413	D	Wall	U Ctr		Intact	Drywall	White	0
414	A	Ceiling			Intact	Drywall	White	0
415	A	Horiz Beam	Ctr		Intact	Concrete	White	0.1
416	A	Heater Vent	Ctr		Intact	Metal	White	0
417	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
418	A	Window	Ctr	Sash	Intact	Wood	Varnish	0
419	B	Baseboard	Ctr		Intact	Wood	Varnish	0.1
420	C	Cabinet	Ctr		Intact	Wood	Varnish	0
Kitchen								
421	A	Wall	U Ctr		Intact	Drywall	White	0
422	B	Wall	U Ctr		Intact	Drywall	White	0.1
423	C	Wall	U Ctr		Intact	Drywall	White	0.1
424	D	Wall	U Ctr		Intact	Drywall	White	0
425	A	Ceiling			Intact	Drywall	White	0
426	A	Cabinet	Ctr		Intact	Wood	Varnish	0
427	B	Baseboard	Ctr		Intact	Wood	Varnish	0
428	C	Closet	Lft	Shelf	Intact	Metal	White	0
429	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
430	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
431	D	Trim	Ctr		Intact	Metal	White	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
Apartment 411								
Bedroom								
432	A	Wall	U Ctr		Intact	Drywall	White	0.1
433	B	Wall	U Ctr		Intact	Drywall	White	0
434	C	Wall	U Ctr		Intact	Drywall	White	0.1
435	D	Wall	U Ctr		Intact	Drywall	White	0
436	A	Ceiling			Intact	Drywall	White	0.2
437	C	Heater Vent	Ctr		Intact	Metal	White	0.1
438	C	Horiz Beam	Ctr		Intact	Concrete	White	0
439	C	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
440	C	Window	Ctr	Sash	Intact	Wood	Varnish	0
441	D	Baseboard	Ctr		Intact	Wood	Varnish	0
442	A	Closet	Ctr	Door Casing	Intact	Wood	Varnish	0
443	A	Closet	Ctr	Door	Intact	Wood	Varnish	0
444	A	Closet	Ctr	Shelf	Intact	Metal	White	0.1
445	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
446	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
Bathroom								
447	A	Wall	U Ctr		Intact	Drywall	White	0
448	B	Wall	U Ctr		Intact	Drywall	White	0.1
449	C	Wall	U Ctr		Intact	Drywall	White	0
450	D	Wall	U Ctr		Intact	Drywall	White	0
451	A	Ceiling			Intact	Drywall	White	0
452	D	Cabinet	Ctr		Intact	Wood	Varnish	0
453	C	Heater Vent	Ctr		Intact	Metal	White	0
454	D	Trim	Ctr		Intact	Metal	White	0
455	B	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
456	B	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
Living Room								
457	A	Wall	U Ctr		Intact	Drywall	White	0
458	B	Wall	U Ctr		Intact	Drywall	White	0
459	C	Wall	U Ctr		Intact	Drywall	White	0
460	D	Wall	U Ctr		Intact	Drywall	White	0.1
461	A	Ceiling			Intact	Drywall	White	0.2
462	A	Cabinet	Ctr		Intact	Wood	Varnish	0
463	B	Baseboard	Ctr		Intact	Wood	Varnish	0
464	C	Window	Ctr	Sash	Intact	Wood	Varnish	0
465	C	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
466	C	Heater Vent	Ctr		Intact	Metal	White	0
467	C	Horiz Beam	Ctr		Intact	Concrete	White	0
Kitchen								
468	A	Wall	U Ctr		Intact	Drywall	White	0.1
469	B	Wall	U Ctr		Intact	Drywall	White	0
470	C	Wall	U Ctr		Intact	Drywall	White	0
471	D	Wall	U Ctr		Intact	Drywall	White	0.1
472	A	Ceiling			Intact	Drywall	White	0
473	A	Cabinet	Ctr		Intact	Wood	Varnish	0
474	A	Closet	Lft	Shelf	Intact	Metal	White	0
475	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0
476	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
Apartment 414								
Bedroom Closet								
477	A	Wall	U Ctr		Intact	Drywall	White	0
478	B	Wall	U Ctr		Intact	Drywall	White	0
479	C	Wall	U Ctr		Intact	Drywall	White	0.1
480	D	Wall	U Ctr		Intact	Drywall	White	0
481	A	Ceiling			Intact	Drywall	White	0
482	A	Door	Ctr	Lft casing	Intact	Wood	Varnish	0
483	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
484	B	Baseboard	Ctr		Intact	Wood	Varnish	0
485	C	Elec Panel	Ctr		Intact	Metal	Gray	0
486	C	Shelf	Ctr		Intact	Metal	White	0.1
487	D	Trim	Ctr		Intact	Metal	White	0.1
488	D	Cabinet	Ctr		Intact	Wood	Varnish	0
Bedroom								
489	A	Wall	U Ctr		Intact	Drywall	White	0
490	B	Wall	U Ctr		Intact	Drywall	White	0.1
491	C	Wall	U Ctr		Intact	Drywall	White	0.1
492	D	Wall	U Ctr		Intact	Drywall	White	0
493	A	Ceiling			Intact	Drywall	White	0
494	A	Heater Vent	Ctr		Intact	Metal	White	0.2
495	A	Horiz Beam	Ctr		Intact	Concrete	White	0
496	A	Window	Lft	Lft casing	Intact	Wood	Varnish	0
497	A	Window	Lft	Sash	Intact	Wood	Varnish	0
498	A	Window	Rgt	Sash	Intact	Wood	Varnish	0
499	A	Window	Rgt	Lft casing	Intact	Wood	Varnish	0
500	C	Baseboard	Ctr		Intact	Wood	Varnish	0
501	D	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
502	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0
Bathroom								
503	A	Wall	U Ctr		Intact	Drywall	White	0
504	B	Wall	U Ctr		Intact	Drywall	White	0
505	C	Wall	U Ctr		Intact	Drywall	White	0
506	D	Wall	U Ctr		Intact	Drywall	White	0
507	A	Ceiling			Intact	Drywall	White	0.1
508	B	Cabinet	Ctr		Intact	Wood	Varnish	0.1
509	C	Shelf	Ctr		Intact	Wood	Varnish	0.1
510	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
511	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0
512	A	Wall	U Ctr		Intact	Drywall	White	0
513	B	Wall	U Ctr		Intact	Drywall	White	0
514	C	Wall	U Ctr		Intact	Drywall	White	0
515	D	Wall	U Ctr		Intact	Drywall	White	0
516	A	Ceiling			Intact	Drywall	White	0
517	A	Heater Vent	Ctr		Intact	Metal	White	0
518	A	Horiz Beam	Ctr		Intact	Concrete	White	0
519	A	Window	Lft	Lft casing	Intact	Wood	Varnish	0
520	A	Window	Lft	Sash	Intact	Wood	Varnish	0
521	A	Window	Rgt	Rgt casing	Intact	Wood	Varnish	0.2
522	A	Window	Rgt	Sash	Intact	Wood	Varnish	0
523	C	Baseboard	Ctr		Intact	Wood	Varnish	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
524	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0.1
525	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
526	B	Closet	Lft	Door Casing	Intact	Wood	Varnish	0
527	B	Closet	Lft	Door	Intact	Wood	Varnish	0.1
528	B	Closet	Lft	Shelf	Intact	Metal	White	0
Kitchen								
529	B	Wall	U Ctr		Intact	Drywall	White	0.1
530	C	Wall	U Ctr		Intact	Drywall	White	0.1
531	D	Wall	U Ctr		Intact	Drywall	White	0
532	A	Ceiling			Intact	Drywall	White	0
533	C	Cabinet	Ctr		Intact	Wood	Varnish	0.1
Apartment 401								
Bedroom								
534	A	Wall	U Ctr		Intact	Drywall	White	0.1
535	B	Wall	U Ctr		Intact	Drywall	White	0
536	C	Wall	U Ctr		Intact	Drywall	White	0
537	D	Wall	U Ctr		Intact	Drywall	White	0
538	A	Ceiling			Intact	Drywall	White	0.1
539	A	Heater Vent	Ctr		Intact	Metal	White	0.1
540	A	Horiz Beam	Ctr		Intact	Concrete	White	0
541	A	Window	Ctr	Sash	Intact	Wood	Varnish	0.1
542	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0.1
543	C	Baseboard	Ctr		Intact	Wood	Varnish	0
544	C	Closet	Ctr	Door Casing	Intact	Wood	Varnish	0
545	C	Closet	Ctr	Door	Intact	Wood	Varnish	0.1
546	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0.1
547	C	Closet	Ctr	Shelf	Intact	Metal	White	0
548	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
Bathroom								
549	A	Wall	U Ctr		Intact	Drywall	White	0
550	B	Wall	U Ctr		Intact	Drywall	White	0.1
551	C	Wall	U Ctr		Intact	Drywall	White	0
552	D	Wall	U Ctr		Intact	Drywall	White	0
553	A	Ceiling			Intact	Drywall	White	0.1
554	B	Trim	Ctr		Intact	Metal	White	0.2
555	B	Cabinet	Ctr		Intact	Wood	Varnish	0
556	D	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
557	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
Living Room								
558	A	Wall	U Ctr		Intact	Drywall	White	0
559	B	Wall	U Ctr		Intact	Drywall	White	0
560	C	Wall	U Ctr		Intact	Drywall	White	0
561	D	Wall	U Ctr		Intact	Drywall	White	0
562	A	Ceiling			Intact	Drywall	White	0.1
563	A	Heater Vent	Ctr		Intact	Metal	White	0.2
564	A	Horiz Beam	Ctr		Intact	Concrete	White	0
565	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
566	A	Window	Ctr	Sash	Intact	Wood	Varnish	0
567	C	Baseboard	Ctr		Intact	Wood	Varnish	0
568	C	Cabinet	Ctr		Intact	Wood	Varnish	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
Kitchen								
569	A	Wall	U Ctr		Intact	Drywall	White	0
570	B	Wall	U Ctr		Intact	Drywall	White	0.2
571	C	Wall	U Ctr		Intact	Drywall	White	0
572	D	Wall	U Ctr		Intact	Drywall	White	0
573	A	Ceiling			Intact	Drywall	White	0
574	B	Baseboard	Ctr		Intact	Wood	Varnish	0
575	C	Cabinet	Ctr		Intact	Wood	Varnish	0
576	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
577	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
578	C	Closet	Ctr	Shelf	Intact	Metal	White	0
Apartment 501								
Bedroom								
579	A	Wall	U Ctr		Intact	Drywall	White	0
580	B	Wall	U Ctr		Intact	Drywall	White	0.1
581	C	Wall	U Ctr		Intact	Drywall	White	0
582	D	Wall	U Ctr		Intact	Drywall	White	0
583	A	Ceiling			Intact	Drywall	White	0
584	A	Heater Vent	Ctr		Intact	Metal	White	0
585	A	Horiz Beam	Ctr		Intact	Concrete	White	0
586	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
587	A	Window	Ctr	Sash	Intact	Wood	Varnish	0
588	C	Closet	Ctr	Door Casing	Intact	Wood	Varnish	0
589	C	Closet	Ctr	Door	Intact	Wood	Varnish	0
590	C	Closet	Ctr	Shelf	Intact	Metal	White	0
591	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
592	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
593	C	Baseboard	Ctr		Intact	Wood	Varnish	0
Bathroom								
594	A	Wall	U Ctr		Intact	Drywall	White	0
595	B	Wall	U Ctr		Intact	Drywall	White	0
596	C	Wall	U Ctr		Intact	Drywall	White	0.1
597	D	Wall	U Ctr		Intact	Drywall	White	0.1
598	A	Ceiling			Intact	Drywall	White	0.1
599	B	Trim	Ctr		Intact	Metal	White	0
600	B	Cabinet	Ctr		Intact	Wood	Varnish	0
601	D	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
602	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0
Living Room								
603	A	Wall	U Ctr		Intact	Drywall	White	0.1
604	B	Wall	U Ctr		Intact	Drywall	White	0.2
605	C	Wall	U Ctr		Intact	Drywall	White	0
606	D	Wall	U Ctr		Intact	Drywall	White	0
607	A	Ceiling			Intact	Drywall	White	0.4
608	A	Heater Vent	Ctr		Intact	Metal	White	0
609	A	Horiz Beam	Ctr		Intact	Concrete	White	0.1
610	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0.1
611	A	Window	Ctr	Sash	Intact	Wood	Varnish	0.1
612	C	Baseboard	Ctr		Intact	Wood	Varnish	0.1
613	C	Cabinet	Ctr		Intact	Wood	Varnish	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
Kitchen								
614	A	Wall	U Ctr		Intact	Drywall	White	0
615	B	Wall	U Ctr		Intact	Drywall	White	0
616	C	Wall	U Ctr		Intact	Drywall	White	0
617	D	Wall	U Ctr		Intact	Drywall	White	0
618	A	Ceiling			Intact	Drywall	White	0.1
619	A	Cabinet	Ctr		Intact	Wood	Varnish	0
620	B	Baseboard	Ctr		Intact	Wood	Varnish	0
621	C	Closet	Ctr	Shelf	Intact	Metal	White	0.1
622	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
623	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0.1
Apartment 511								
Bedroom								
624	A	Wall	U Ctr		Intact	Drywall	White	0.1
625	B	Wall	U Ctr		Intact	Drywall	White	0.1
626	C	Wall	U Ctr		Intact	Drywall	White	0
627	D	Wall	U Ctr		Intact	Drywall	White	0
628	A	Ceiling			Intact	Drywall	White	0
629	C	Heater Vent	Ctr		Intact	Metal	White	0.2
630	C	Horiz Beam	Ctr		Intact	Concrete	White	0.2
631	C	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
632	C	Window	Ctr	Sash	Intact	Wood	Varnish	0
633	A	Wall	L Ctr		Intact	Wood	Varnish	0
634	A	Closet	Ctr	Door Casing	Intact	Wood	Varnish	0.1
635	A	Closet	Ctr	Door	Intact	Wood	Varnish	0
636	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0.1
637	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0
638	A	Closet	Ctr	Shelf	Intact	Metal	White	0.1
Bathroom								
639	B	Door	Ctr	Lft casing	Intact	Metal	Gray	0
640	B	Door	Ctr	U Ctr	Intact	Wood	Varnish	0.1
641	A	Wall	U Ctr		Intact	Drywall	White	0
642	B	Wall	U Ctr		Intact	Drywall	White	0
643	C	Wall	U Ctr		Intact	Drywall	White	0.1
644	D	Wall	U Ctr		Intact	Drywall	White	0
645	A	Ceiling			Intact	Drywall	White	0
646	D	Cabinet	Ctr		Intact	Wood	Varnish	0
647	D	Trim	Ctr		Intact	Metal	White	0
648	C	Heater Vent	Ctr		Intact	Metal	White	0
Living Room								
649	A	Wall	U Ctr		Intact	Drywall	White	0
650	B	Wall	U Ctr		Intact	Drywall	White	0.1
651	C	Wall	U Ctr		Intact	Drywall	White	0.1
652	D	Wall	U Ctr		Intact	Drywall	White	0
653	A	Ceiling			Intact	Drywall	White	0
654	A	Heater Vent	Ctr		Intact	Metal	White	0.1
655	A	Horiz Beam	Ctr		Intact	Concrete	White	0.2
656	C	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
657	C	Window	Ctr	Sash	Intact	Wood	Varnish	0
658	A	Cabinet	Ctr		Intact	Wood	Varnish	0.1
659	A	Baseboard	Ctr		Intact	Wood	Varnish	0.1

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
Kitchen								
660	A	Wall	U Ctr		Intact	Drywall	White	0
661	B	Wall	U Ctr		Intact	Drywall	White	0
662	C	Wall	U Ctr		Intact	Drywall	White	0
663	D	Wall	U Ctr		Intact	Drywall	White	0.1
664	A	Ceiling			Intact	Drywall	White	0.1
665	A	Cabinet	Ctr		Intact	Wood	Varnish	0
666	D	Baseboard	Ctr		Intact	Wood	Varnish	0
667	A	Closet	Lft	Shelf	Intact	Metal	White	0
668	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0
669	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
Apartment 508								
Bedroom Closet								
670	A	Wall	U Ctr		Intact	Drywall	White	0
671	B	Wall	U Ctr		Intact	Drywall	White	0
672	C	Wall	U Ctr		Intact	Drywall	White	0
673	D	Wall	U Ctr		Intact	Drywall	White	0
674	A	Ceiling			Intact	Drywall	White	0
675	C	Shelf	Ctr		Intact	Metal	White	0.1
676	C	Baseboard	Ctr		Intact	Wood	Varnish	0.1
677	C	Door	Ctr	Lft casing	Intact	Wood	Varnish	0
678	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0.1
679	D	Cabinet	Ctr		Intact	Wood	Varnish	0.1
680	D	Shelf	Ctr		Intact	Metal	White	0
681	A	Wall	U Ctr		Intact	Drywall	White	0
682	B	Wall	U Ctr		Intact	Drywall	White	0.1
683	C	Wall	U Ctr		Intact	Drywall	White	0
684	D	Wall	U Ctr		Intact	Drywall	White	0
685	A	Ceiling			Intact	Drywall	White	0.1
686	C	Heater Vent	Ctr		Intact	Metal	White	0
687	C	Horiz Beam	Ctr		Intact	Concrete	White	0
688	C	Window	Lft	Lft casing	Intact	Wood	Varnish	0
689	C	Window	Lft	Sash	Intact	Wood	Varnish	0
690	C	Window	Rgt	Sash	Intact	Wood	Varnish	0
691	C	Window	Rgt	Lft casing	Intact	Wood	Varnish	0
692	A	Baseboard	Ctr		Intact	Wood	Varnish	0
693	D	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
694	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0
Bathroom								
695	A	Wall	U Ctr		Intact	Drywall	White	0
696	B	Wall	U Ctr		Intact	Drywall	White	0
697	C	Wall	U Ctr		Intact	Drywall	White	0
698	D	Wall	U Ctr		Intact	Drywall	White	0
699	A	Ceiling			Intact	Drywall	White	0.1
700	A	Shelf	Ctr		Intact	Wood	Varnish	0.1
701	B	Cabinet	Ctr		Intact	Wood	Varnish	0.1
702	B	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
703	B	Door	Ctr	Lft casing	Intact	Metal	Gray	0
Kitchen								
704	A	Wall	U Ctr		Intact	Drywall	White	0
705	B	Wall	U Ctr		Intact	Drywall	White	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
706	D	Wall	U Ctr		Intact	Drywall	White	0.1
707	A	Ceiling			Intact	Drywall	White	0
708	A	Cabinet	Ctr		Intact	Wood	Varnish	0
Living Room								
709	A	Wall	U Ctr		Intact	Drywall	White	0.1
710	B	Wall	U Ctr		Intact	Drywall	White	0.1
711	C	Wall	U Ctr		Intact	Drywall	White	0
712	D	Wall	U Ctr		Intact	Drywall	White	0
713	A	Ceiling			Intact	Drywall	White	0
714	C	Heater Vent	Ctr		Intact	Metal	White	0.1
715	C	Horiz Beam	Ctr		Intact	Concrete	White	0.4
716	C	Window	Lft	Lft casing	Intact	Wood	Varnish	0
717	C	Window	Lft	Sash	Intact	Wood	Varnish	0
718	C	Window	Rgt	Lft casing	Intact	Wood	Varnish	0
719	C	Window	Rgt	Sash	Intact	Wood	Varnish	0
720	A	Baseboard	Ctr		Intact	Wood	Varnish	0.1
721	B	Closet	Lft	Door	Intact	Wood	Varnish	0
722	B	Closet	Lft	Door Casing	Intact	Wood	Varnish	0.1
723	B	Closet	Lft	Shelf	Intact	Metal	White	0
724	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0
725	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
Apartment 602								
Bedroom								
734	A	Wall	U Ctr		Intact	Drywall	White	0
735	B	Wall	U Ctr		Intact	Drywall	White	0
736	C	Wall	U Ctr		Intact	Drywall	White	0
737	D	Wall	U Ctr		Intact	Drywall	White	0
738	A	Ceiling			Intact	Drywall	White	0.2
739	A	Heater Vent	Ctr		Intact	Metal	White	0
740	A	Horiz Beam	Ctr		Intact	Concrete	White	0
741	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
742	A	Window	Ctr	Sill	Intact	Wood	Varnish	0
743	B	Baseboard	Ctr		Intact	Wood	Varnish	0
Bathroom								
744	C	Closet	Ctr	Door Casing	Intact	Wood	Varnish	0
745	C	Closet	Ctr	Door	Intact	Wood	Varnish	0
746	C	Closet	Ctr	Shelf	Intact	Metal	White	0.1
747	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
748	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0.1
749	A	Wall	U Ctr		Intact	Drywall	White	0
750	B	Wall	U Ctr		Intact	Drywall	White	0
751	C	Wall	U Ctr		Intact	Drywall	White	0.1
752	D	Wall	U Ctr		Intact	Drywall	White	0.1
753	A	Ceiling			Intact	Drywall	White	0.1
754	D	Cabinet	Ctr		Intact	Wood	Varnish	0
755	B	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
756	B	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
Living Room								
757	A	Wall	U Ctr		Intact	Drywall	White	0
758	B	Wall	U Ctr		Intact	Drywall	White	0
759	C	Wall	U Ctr		Intact	Drywall	White	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
760	D	Wall	U Ctr		Intact	Drywall	White	0.1
761	A	Ceiling			Intact	Drywall	White	0
762	A	Horiz Beam	Ctr		Intact	Concrete	White	0
763	A	Heater Vent	Ctr		Intact	Metal	White	0.2
764	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
765	A	Window	Ctr	Sash	Intact	Wood	Varnish	0
766	B	Baseboard	Ctr		Intact	Wood	Varnish	0
767	C	Cabinet	Ctr		Intact	Wood	Varnish	0
Kitchen								
768	A	Wall	U Ctr		Intact	Drywall	White	0
769	B	Wall	U Ctr		Intact	Drywall	White	0
770	C	Wall	U Ctr		Intact	Drywall	White	0.1
771	D	Wall	U Ctr		Intact	Drywall	White	0.1
772	A	Ceiling			Intact	Drywall	White	0
773	C	Cabinet	Ctr		Intact	Wood	Varnish	0
774	D	Baseboard	Ctr		Intact	Wood	Varnish	0
775	C	Shelf	Ctr		Intact	Metal	White	0
776	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
777	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0.1
Apartment 608								
Bedroom Closet								
778	A	Wall	U Ctr		Intact	Drywall	White	0
779	B	Wall	U Ctr		Intact	Drywall	White	0
780	C	Wall	U Ctr		Intact	Drywall	White	0
781	D	Wall	U Ctr		Intact	Drywall	White	0
782	A	Ceiling			Intact	Drywall	White	0.1
783	D	Shelf	Ctr		Intact	Metal	White	0
784	D	Trim	Ctr		Intact	Metal	White	0
785	A	Elec Panel	Ctr		Intact	Metal	Gray	0
786	D	Cabinet	Ctr		Intact	Wood	Varnish	0
787	C	Baseboard	Ctr		Intact	Wood	Varnish	0
788	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
789	C	Door	Ctr	Lft casing	Intact	Wood	Varnish	0
Bedroom								
790	A	Wall	U Ctr		Intact	Drywall	White	0
791	B	Wall	U Ctr		Intact	Drywall	White	0
792	C	Wall	U Ctr		Intact	Drywall	White	0.2
793	D	Wall	U Ctr		Intact	Drywall	White	0
794	A	Ceiling			Intact	Drywall	White	0
795	C	Horiz Beam	Ctr		Intact	Concrete	White	0.1
796	C	Heater Vent	Ctr		Intact	Metal	White	0
797	C	Window	Lft	Lft casing	Intact	Wood	Varnish	0
798	C	Window	Lft	Sash	Intact	Wood	Varnish	0
799	C	Window	Rgt	Lft casing	Intact	Wood	Varnish	0
800	C	Window	Rgt	Sash	Intact	Wood	Varnish	0
801	D	Baseboard	Ctr		Intact	Wood	Varnish	0.1
802	D	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
803	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0
Bathroom								
804	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
805	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
806	A	Shelf	Ctr		Intact	Wood	Varnish	0
807	B	Cabinet	Ctr		Intact	Wood	Varnish	0
808	A	Wall	U Ctr		Intact	Drywall	White	0.1
809	B	Wall	U Ctr		Intact	Drywall	White	0
810	C	Wall	U Ctr		Intact	Drywall	White	0
811	D	Wall	U Ctr		Intact	Drywall	White	0
812	A	Ceiling			Intact	Drywall	White	0.1
Kitchen								
813	A	Ceiling			Intact	Drywall	White	0.1
814	A	Wall	U Ctr		Intact	Drywall	White	0.1
815	B	Wall	U Ctr		Intact	Drywall	White	0
816	D	Wall	U Ctr		Intact	Drywall	White	0
817	A	Cabinet	Ctr		Intact	Wood	Varnish	0
Living Room								
818	A	Wall	U Ctr		Intact	Drywall	White	0.1
819	B	Wall	U Ctr		Intact	Drywall	White	0
820	C	Wall	U Ctr		Intact	Drywall	White	0
821	D	Wall	U Ctr		Intact	Drywall	White	0
822	A	Ceiling			Intact	Drywall	White	0.1
823	C	Horiz Beam	Ctr		Intact	Concrete	White	0
824	C	Heater Vent	Ctr		Intact	Metal	White	0.1
825	C	Window	Lft	Lft casing	Intact	Wood	Varnish	0
826	C	Window	Lft	Sash	Intact	Wood	Varnish	0
827	C	Window	Rgt	Sash	Intact	Wood	Varnish	0
828	C	Window	Rgt	Lft casing	Intact	Wood	Varnish	0
829	A	Baseboard	Ctr		Intact	Wood	Varnish	0.1
830	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
831	B	Closet	Lft	Door	Intact	Wood	Varnish	0
832	B	Closet	Lft	Door Casing	Intact	Wood	Varnish	0
833	B	Closet	Lft	Shelf	Intact	Metal	White	0
834	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0
835	B	Trim	Lft		Intact	Metal	White	0
Apartment 610								
Bedroom								
836	A	Wall	U Ctr		Intact	Drywall	White	0
837	B	Wall	U Ctr		Intact	Drywall	White	0.1
838	C	Wall	U Ctr		Intact	Drywall	White	0
839	D	Wall	U Ctr		Intact	Drywall	White	0.1
840	A	Ceiling			Intact	Drywall	White	0.2
841	C	Heater Vent	Ctr		Intact	Metal	White	0
842	C	Horiz Beam	Ctr		Intact	Concrete	White	0.1
843	C	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
844	C	Window	Ctr	Sash	Intact	Wood	Varnish	0
845	D	Baseboard	Ctr		Intact	Wood	Varnish	0.1
846	A	Closet	Ctr	Door	Intact	Wood	Varnish	0
847	A	Closet	Ctr	Door Casing	Intact	Wood	Varnish	0.1
848	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
849	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
850	A	Closet	Ctr	Shelf	Intact	Metal	White	0.1
Bathroom								
851	A	Wall	U Ctr		Intact	Drywall	White	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
852	B	Wall	U Ctr		Intact	Drywall	White	0
853	C	Wall	U Ctr		Intact	Drywall	White	0
854	D	Wall	U Ctr		Intact	Drywall	White	0.1
855	A	Ceiling			Intact	Drywall	White	0.3
856	B	Cabinet	Ctr		Intact	Wood	Varnish	0
857	D	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
858	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0
Living Room								
859	A	Wall	U Ctr		Intact	Drywall	White	0.1
860	B	Wall	U Ctr		Intact	Drywall	White	0
861	C	Wall	U Ctr		Intact	Drywall	White	0
862	D	Wall	U Ctr		Intact	Drywall	White	0
863	A	Ceiling			Intact	Drywall	White	0.1
864	C	Heater Vent	Ctr		Intact	Metal	White	0
865	C	Horiz Beam	Ctr		Intact	Concrete	White	0.2
866	A	Cabinet	Ctr		Intact	Wood	Varnish	0
867	C	Window	Ctr	Sill	Intact	Wood	Varnish	0
868	C	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
869	D	Baseboard	Ctr		Intact	Wood	Varnish	0
Kitchen								
870	A	Wall	U Ctr		Intact	Drywall	White	0
871	B	Wall	U Ctr		Intact	Drywall	White	0.1
872	C	Wall	U Ctr		Intact	Drywall	White	0
873	D	Wall	U Ctr		Intact	Drywall	White	0
874	A	Ceiling			Intact	Drywall	White	0
875	A	Cabinet	Ctr		Intact	Wood	Varnish	0.1
876	B	Baseboard	Ctr		Intact	Wood	Varnish	0
877	D	Trim	Ctr		Intact	Metal	White	0.1
878	A	Closet	Rgt	Shelf	Intact	Metal	White	0
879	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0
880	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
Apartment 701								
Bedroom								
881	A	Wall	U Ctr		Intact	Drywall	White	0
882	B	Wall	U Ctr		Intact	Drywall	White	0
883	C	Wall	U Ctr		Intact	Drywall	White	0
884	D	Wall	U Ctr		Intact	Drywall	White	0.1
885	A	Ceiling			Intact	Drywall	White	0
886	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
887	A	Window	Ctr	Sill	Intact	Wood	Varnish	0
888	A	Heater Vent	Ctr		Intact	Metal	White	0
889	A	Horiz Beam	Ctr		Intact	Concrete	White	0
890	B	Baseboard	Ctr		Intact	Wood	Varnish	0
891	C	Closet	Ctr	Door	Intact	Wood	Varnish	0
892	C	Closet	Ctr	Door Casing	Intact	Wood	Varnish	0.1
893	C	Closet	Ctr	Shelf	Intact	Metal	White	0
894	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
895	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
Bathroom								
896	A	Wall	U Ctr		Intact	Drywall	White	0.1
897	B	Wall	U Ctr		Intact	Drywall	White	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
898	C	Wall	U Ctr		Intact	Drywall	White	0.1
899	D	Wall	U Ctr		Intact	Drywall	White	0
900	A	Ceiling			Intact	Drywall	White	0.1
901	B	Cabinet	Ctr		Intact	Wood	Varnish	0
902	D	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
903	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
904	A	Heater Vent	Ctr		Intact	Metal	White	0
905	B	Trim	Ctr		Intact	Metal	White	0.1
Living Room								
906	A	Wall	U Ctr		Intact	Drywall	White	0
907	B	Wall	U Ctr		Intact	Drywall	White	0.1
908	C	Wall	U Ctr		Intact	Drywall	White	0
909	D	Chair rail	Ctr		Intact	Drywall	White	0
910	A	Ceiling			Intact	Drywall	White	0
911	A	Heater Vent	Ctr		Intact	Metal	White	0
912	A	Horiz Beam	Ctr		Intact	Concrete	White	0
913	B	Baseboard	Ctr		Intact	Wood	Varnish	0
914	C	Cabinet	Ctr		Intact	Wood	Varnish	0.3
915	A	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
916	A	Window	Ctr	Sash	Intact	Wood	Varnish	0
Kitchen								
917	A	Wall	U Ctr		Intact	Drywall	White	0
918	B	Wall	U Ctr		Intact	Drywall	White	0
919	C	Wall	U Ctr		Intact	Drywall	White	0.2
920	D	Wall	U Ctr		Intact	Drywall	White	0
921	A	Ceiling			Intact	Drywall	White	0
922	C	Cabinet	Ctr		Intact	Wood	Varnish	0
923	C	Closet	Lft	Shelf	Intact	Metal	White	0
924	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
925	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
926	D	Trim	Ctr		Intact	Metal	Gray	0
Apartment 708								
Bedroom Closet								
927	A	Wall	U Ctr		Intact	Drywall	White	0
928	B	Wall	U Ctr		Intact	Drywall	White	0.1
929	C	Wall	U Ctr		Intact	Drywall	White	0.1
930	D	Wall	U Ctr		Intact	Drywall	White	0
931	A	Ceiling			Intact	Drywall	White	0.1
932	A	Elec Panel	Ctr		Intact	Metal	Gray	0
933	A	Shelf	Ctr		Intact	Metal	White	0
934	C	Baseboard	Ctr		Intact	Wood	Varnish	0
935	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0.1
936	C	Door	Ctr	Lft casing	Intact	Wood	Varnish	0
937	D	Cabinet	Ctr		Intact	Wood	Varnish	0
938	D	Trim	Ctr		Intact	Metal	White	0
Bedroom								
939	A	Wall	U Ctr		Intact	Drywall	White	0
940	B	Wall	U Ctr		Intact	Drywall	White	0
941	C	Wall	U Ctr		Intact	Drywall	White	0
942	D	Wall	U Ctr		Intact	Drywall	White	0
943	A	Ceiling			Intact	Drywall	White	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
944	C	Horiz Beam	Ctr		Intact	Concrete	White	0
945	C	Heater Vent	Ctr		Intact	Metal	White	0
946	C	Window	Lft	Lft casing	Intact	Wood	Varnish	0
947	C	Window	Lft	Sash	Intact	Wood	Varnish	0
948	D	Baseboard	Ctr		Intact	Wood	Varnish	0
949	D	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
950	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0
Bathroom								
951	A	Wall	U Ctr		Intact	Drywall	White	0
952	B	Wall	U Ctr		Intact	Drywall	White	0
953	C	Wall	U Ctr		Intact	Drywall	White	0
954	D	Wall	U Ctr		Intact	Drywall	White	0
955	A	Ceiling			Intact	Drywall	White	0.1
956	A	Shelf	Ctr		Intact	Wood	Varnish	0.1
957	B	Cabinet	Ctr		Intact	Wood	Varnish	0
958	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
959	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
960	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
Kitchen								
961	A	Wall	U Ctr		Intact	Drywall	White	0.1
962	B	Wall	U Ctr		Intact	Drywall	White	0.1
963	D	Wall	U Ctr		Intact	Drywall	White	0.1
964	A	Ceiling			Intact	Drywall	White	0.1
965	A	Cabinet	Ctr		Intact	Wood	Varnish	0
Living Room								
966	A	Wall	U Ctr		Intact	Drywall	White	0.1
967	B	Wall	U Ctr		Intact	Drywall	White	0
968	C	Wall	U Ctr		Intact	Drywall	White	0.1
969	D	Wall	U Ctr		Intact	Drywall	White	0.1
970	A	Ceiling			Intact	Drywall	White	0
971	C	Horiz Beam	Ctr		Intact	Concrete	White	0
972	C	Heater Vent	Ctr		Intact	Metal	White	0
973	C	Window	Lft	Lft casing	Intact	Wood	Varnish	0
974	C	Window	Lft	Sash	Intact	Wood	Varnish	0
975	C	Window	Rgt	Sash	Intact	Wood	Varnish	0
976	C	Window	Rgt	Lft casing	Intact	Wood	Varnish	0
977	B	Baseboard	Ctr		Intact	Wood	Varnish	0
978	B	Closet	Lft	Door	Intact	Wood	Varnish	0
979	B	Closet	Lft	Door Casing	Intact	Wood	Varnish	0
980	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0.1
981	B	Closet	Lft	Shelf	Intact	Metal	White	0
982	D	Trim	Ctr		Intact	Metal	White	0.1
983	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
Apartment 709								
Bedroom								
984	A	Wall	U Ctr		Intact	Drywall	White	0.1
985	B	Wall	U Ctr		Intact	Drywall	White	0
986	C	Wall	U Ctr		Intact	Drywall	White	0
987	D	Wall	U Ctr		Intact	Drywall	White	0
988	A	Ceiling			Intact	Drywall	White	0.2
989	C	Heater Vent	Ctr		Intact	Metal	White	0.2

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
990	C	Horiz Beam	Ctr		Intact	Concrete	White	0
991	C	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
992	C	Window	Ctr	Sash	Intact	Wood	Varnish	0.1
993	A	Closet	Ctr	Door Casing	Intact	Wood	Varnish	0
994	A	Closet	Ctr	Door	Intact	Wood	Varnish	0
995	A	Wall	L Ctr		Intact	Wood	Varnish	0
996	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
997	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0
998	A	Closet	Ctr	Shelf	Intact	Metal	White	0.1
Bathroom								
999	A	Door	Ctr	Lft casing	Intact	Metal	White	0
1000	A	Door	Ctr	Door	Intact	Wood	Varnish	0.1
1001	D	Trim	Ctr		Intact	Metal	White	0
1002	D	Cabinet	Ctr		Intact	Wood	Varnish	0
1003	A	Wall	U Ctr		Intact	Drywall	White	0
1004	B	Wall	U Ctr		Intact	Drywall	White	0.1
1005	C	Wall	U Ctr		Intact	Drywall	White	0.1
1006	D	Wall	U Ctr		Intact	Drywall	White	0.1
1007	A	Ceiling			Intact	Drywall	White	0.2
1008	C	Heater Vent	Ctr		Intact	Metal	White	0
Living Room								
1009	A	Wall	U Ctr		Intact	Drywall	White	0.1
1010	B	Wall	U Ctr		Intact	Drywall	White	0
1011	C	Wall	U Ctr		Intact	Drywall	White	0.1
1012	D	Wall	U Ctr		Intact	Drywall	White	0
1013	A	Ceiling			Intact	Drywall	White	0
1014	C	Heater Vent	Ctr		Intact	Metal	White	0.1
1015	C	Horiz Beam	Ctr		Intact	Concrete	White	0
1016	C	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
1017	C	Window	Ctr	Sash	Intact	Wood	Varnish	0
1018	A	Baseboard	Ctr		Intact	Wood	Varnish	0.3
1019	A	Cabinet	Ctr		Intact	Wood	Varnish	0.2
1020	B	Trim	Ctr		Intact	Metal	White	0
Kitchen								
1021	B	Trim	Ctr		Intact	Metal	White	0
1022	A	Wall	U Ctr		Intact	Drywall	White	0
1023	B	Wall	U Ctr		Intact	Drywall	White	0.1
1024	C	Wall	U Ctr		Intact	Drywall	White	0
1025	D	Wall	U Ctr		Intact	Drywall	White	0
1026	D	Ceiling			Intact	Drywall	White	0
1027	A	Cabinet	Ctr		Intact	Wood	Varnish	0.1
1028	D	Baseboard	Ctr		Intact	Wood	Varnish	0
1029	A	Closet	Lft	Shelf	Intact	Metal	White	0
1030	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1031	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
Apartment 710								
Bedroom								
1032	A	Wall	U Ctr		Intact	Drywall	White	0.1
1033	B	Wall	U Ctr		Intact	Drywall	White	0
1034	C	Wall	U Ctr		Intact	Drywall	White	0
1035	D	Wall	U Ctr		Intact	Drywall	White	0.1

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
1036	A	Ceiling			Intact	Drywall	White	0
1037	C	Heater Vent	Ctr		Intact	Metal	White	0
1038	C	Horiz Beam	Ctr		Intact	Concrete	White	0.1
1039	D	Baseboard	Ctr		Intact	Wood	Varnish	0
1040	A	Closet	Ctr	Door	Intact	Wood	Varnish	0
1041	A	Closet	Ctr	Door Casing	Intact	Wood	Varnish	0
1042	C	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
1043	C	Window	Ctr	Sash	Intact	Wood	Varnish	0
1044	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1045	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1046	A	Closet	Ctr	Shelf	Intact	Metal	White	0.2
Bathroom								
1047	A	Wall	U Ctr		Intact	Drywall	White	0
1048	B	Wall	U Ctr		Intact	Drywall	White	0.1
1049	C	Wall	U Ctr		Intact	Drywall	White	0
1050	D	Wall	U Ctr		Intact	Drywall	White	0
1051	A	Ceiling			Intact	Drywall	White	0.1
1052	B	Cabinet	Ctr		Intact	Wood	Varnish	0
1053	D	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1054	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
Living Room								
1055	A	Wall	U Ctr		Intact	Drywall	White	0
1056	B	Wall	U Ctr		Intact	Drywall	White	0.1
1057	C	Wall	U Ctr		Intact	Drywall	White	0
1058	D	Wall	U Ctr		Intact	Drywall	White	0
1059	A	Ceiling			Intact	Drywall	White	0.1
1060	C	Heater Vent	Ctr		Intact	Metal	White	0.1
1061	C	Horiz Beam	Ctr		Intact	Concrete	White	0
1062	C	Window	Ctr	Lft casing	Intact	Wood	Varnish	0
1063	C	Window	Ctr	Sash	Intact	Wood	Varnish	0
1064	B	Baseboard	Ctr		Intact	Wood	Varnish	0
1065	A	Cabinet	Ctr		Intact	Wood	Varnish	0.1
Kitchen								
1066	A	Cabinet	Ctr		Intact	Wood	Varnish	0
1067	B	Baseboard	Ctr		Intact	Wood	Varnish	0
1068	D	Trim	Ctr		Intact	Metal	White	0
1069	A	Wall	U Ctr		Intact	Drywall	White	0
1070	B	Wall	U Ctr		Intact	Drywall	White	0.1
1071	C	Wall	U Ctr		Intact	Drywall	White	0.1
1072	D	Wall	U Ctr		Intact	Drywall	White	0
1073	A	Ceiling			Intact	Drywall	White	0
1074	A	Closet	Ctr	Shelf	Intact	Metal	White	0
1075	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
1076	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
Apartment 715								
Bedroom Closet								
1077	A	Wall	U Ctr		Intact	Drywall	White	0.1
1078	B	Wall	U Ctr		Intact	Drywall	White	0
1079	C	Wall	U Ctr		Intact	Drywall	White	0
1080	D	Wall	U Ctr		Intact	Drywall	White	0
1081	A	Ceiling			Intact	Drywall	White	0.1

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
1082	B	Cabinet	Ctr		Intact	Wood	Varnish	0
1083	C	Shelf	Ctr		Intact	Metal	White	0
1084	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1085	A	Door	Ctr	Lft casing	Intact	Wood	Varnish	0
Bedroom								
1086	A	Wall	U Ctr		Intact	Drywall	White	0
1087	B	Wall	U Ctr		Intact	Drywall	White	0.1
1088	C	Wall	U Ctr		Intact	Drywall	White	0
1089	D	Wall	U Ctr		Intact	Drywall	White	0.2
1090	A	Ceiling			Intact	Drywall	White	0.2
1091	A	Heater Vent	Ctr		Intact	Metal	White	0.2
1092	A	Horiz Beam	Ctr		Intact	Concrete	White	0
1093	A	Window	Lft	Lft casing	Intact	Wood	Varnish	0
1094	A	Window	Lft	Sash	Intact	Wood	Varnish	0
1095	A	Window	Rgt	Sash	Intact	Wood	Varnish	0
1096	B	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1097	B	Door	Ctr	Lft casing	Intact	Metal	Gray	0.1
Bathroom								
1098	A	Wall	U Ctr		Intact	Drywall	White	0
1099	B	Wall	U Ctr		Intact	Drywall	White	0
1100	C	Wall	U Ctr		Intact	Drywall	White	0
1101	D	Wall	U Ctr		Intact	Drywall	White	0
1102	A	Ceiling			Intact	Drywall	White	0.1
1103	D	Cabinet	Ctr		Intact	Wood	Varnish	0
1104	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1105	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0
Kitchen								
1106	B	Wall	U Ctr		Intact	Drywall	White	0
1107	C	Wall	U Ctr		Intact	Drywall	White	0
1108	D	Wall	U Ctr		Intact	Drywall	White	0.1
1109	A	Ceiling			Intact	Drywall	White	0
1110	C	Cabinet	Ctr		Intact	Wood	Varnish	0
Living Room								
1111	A	Wall	U Ctr		Intact	Drywall	White	0.2
1112	B	Wall	U Ctr		Intact	Drywall	White	0
1113	C	Wall	U Ctr		Intact	Drywall	White	0
1114	D	Wall	U Ctr		Intact	Drywall	White	0.1
1115	A	Ceiling			Intact	Drywall	White	0.2
1116	A	Heater Vent	Ctr		Intact	Metal	White	0
1117	A	Horiz Beam	Ctr		Intact	Concrete	White	0
1118	A	Window	Lft	Lft casing	Intact	Wood	Varnish	0
1119	A	Window	Lft	Sash	Intact	Wood	Varnish	0
1120	A	Window	Rgt	Lft casing	Intact	Wood	Varnish	0
1121	A	Window	Rgt	Sash	Intact	Wood	Varnish	0
1122	B	Closet	Rgt	Door Casing	Intact	Wood	Varnish	0
1123	B	Closet	Rgt	Door	Intact	Wood	Varnish	0
1124	B	Closet	Rgt	Shelf	Intact	Wood	White	0
1125	D	Closet	Lft	Shelf	Intact	Metal	White	0
1126	D	Closet	Lft	Door	Intact	Wood	Varnish	0
1127	D	Closet	Lft	Door Casing	Intact	Wood	Varnish	0
1128	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1129	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
Apartment 614								
Bedroom Closet								
1130	A	Wall	U Ctr		Intact	Drywall	White	0.1
1131	B	Wall	U Ctr		Intact	Drywall	White	0.1
1132	C	Wall	U Ctr		Intact	Drywall	White	0
1133	D	Wall	U Ctr		Intact	Drywall	White	0
1134	A	Ceiling			Intact	Drywall	White	0
1135	D	Shelf	Ctr		Intact	Metal	White	0.1
1136	D	Cabinet	Ctr		Intact	Wood	Varnish	0.1
1137	A	Wall	L Ctr		Intact	Wood	Varnish	0
1138	A	Door	Ctr	Lft casing	Intact	Wood	Varnish	0
1139	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
Bedroom								
1140	A	Wall	U Ctr		Intact	Drywall	White	0
1141	B	Wall	U Ctr		Intact	Drywall	White	0
1142	C	Wall	U Ctr		Intact	Drywall	White	0
1143	D	Wall	U Ctr		Intact	Drywall	White	0
1144	A	Ceiling			Intact	Drywall	White	0
1145	A	Heater Vent	Ctr		Intact	Metal	White	0
1146	A	Horiz Beam	Ctr		Intact	Concrete	White	0.1
1147	A	Window	Lft	Lft casing	Intact	Wood	Varnish	0.1
1148	A	Window	Lft	Sash	Intact	Wood	Varnish	0.1
1149	A	Window	Rgt	Lft casing	Intact	Wood	Varnish	0
1150	A	Window	Rgt	Sash	Intact	Wood	Varnish	0.1
1151	D	Baseboard	Ctr		Intact	Wood	Varnish	0.1
1152	D	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1153	D	Door	Ctr	Lft casing	Intact	Metal	Gray	0
Bathroom								
1154	A	Wall	U Ctr		Intact	Drywall	White	0
1155	B	Wall	U Ctr		Intact	Drywall	White	0.1
1156	C	Wall	U Ctr		Intact	Drywall	White	0
1157	D	Wall	U Ctr		Intact	Drywall	White	0.1
1158	A	Ceiling			Intact	Drywall	White	0
1159	B	Cabinet	Ctr		Intact	Wood	Varnish	0
1160	C	Cabinet	Ctr		Intact	Wood	Varnish	0.1
1161	A	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
1162	A	Door	Ctr	Lft casing	Intact	Metal	Gray	0
Kitchen								
1163	B	Wall	U Ctr		Intact	Drywall	White	0.1
1164	C	Wall	U Ctr		Intact	Drywall	White	0
1165	D	Wall	U Ctr		Intact	Drywall	White	0
1166	A	Ceiling			Intact	Drywall	White	0
1167	C	Cabinet	Ctr		Intact	Wood	Varnish	0
Living Room								
1168	A	Wall	U Ctr		Intact	Drywall	White	0
1169	B	Wall	U Ctr		Intact	Drywall	White	0
1170	C	Wall	U Ctr		Intact	Drywall	White	0
1171	D	Wall	U Ctr		Intact	Drywall	White	0
1172	A	Ceiling			Intact	Drywall	White	0
1173	A	Heater Vent	Ctr		Intact	Metal	White	0

Reading No	Wall	Structure	Location	Member	Paint Condition	Substrate	Color	Lead (mg/cm2)
1174	A	Horiz Beam	Ctr		Intact	Concrete	White	0
1175	A	Window	Lft	Lft casing	Intact	Wood	Varnish	0
1176	A	Window	Lft	Sash	Intact	Wood	Varnish	0
1177	A	Window	Rgt	Lft casing	Intact	Wood	Varnish	0
1178	A	Window	Rgt	Sash	Intact	Wood	Varnish	0
1179	C	Baseboard	Ctr		Intact	Wood	Varnish	0
1180	B	Closet	Rgt	Door	Intact	Wood	Varnish	0
1181	B	Closet	Rgt	Door Casing	Intact	Wood	Varnish	0
1182	B	Closet	Rgt	Shelf	Intact	Metal	White	0
1183	C	Door	Ctr	Lft casing	Intact	Metal	Gray	0
1184	C	Door	Ctr	U Ctr	Intact	Wood	Varnish	0
December 4th Midday Calibration								
381								1
382								1.1
383								0.9
384								0
December 5th Midday Calibration								
1185								1
1186								1
1187								1.1
1188								0
December 4th Post-Calibration								
726								0.9
727								0.9
728								1
729								0
December 5th Post-Calibration								
1584								0.9
1585								1
1586								1
1587								0
December 6th Post-Calibration								
1776								1
1777								1
1778								1
1779								0


Abbreviations:	U = Upper	L = Lower	Rgt = Right	Lft = Left	Ctr = Center	Bsmt = Basement
-----------------------	------------------	------------------	--------------------	-------------------	---------------------	------------------------

Notes:

- Wall A (South) is the road/street side (Briggs Court) of the building. Walls B/C/D are determined clockwise from Wall A.
- All similar materials with the same paint history are to be categorized in the same manner. For example, if a window sill on side A is positive for lead-based paint, then all similar window sills are assumed to contain lead-based paint unless specifically tested and proven otherwise.
- Additional areas of lead-based paint are possible in inaccessible areas, areas hidden from view or materials/substrates contained behind or within other building materials.



Appendix B

SITE DIAGRAM

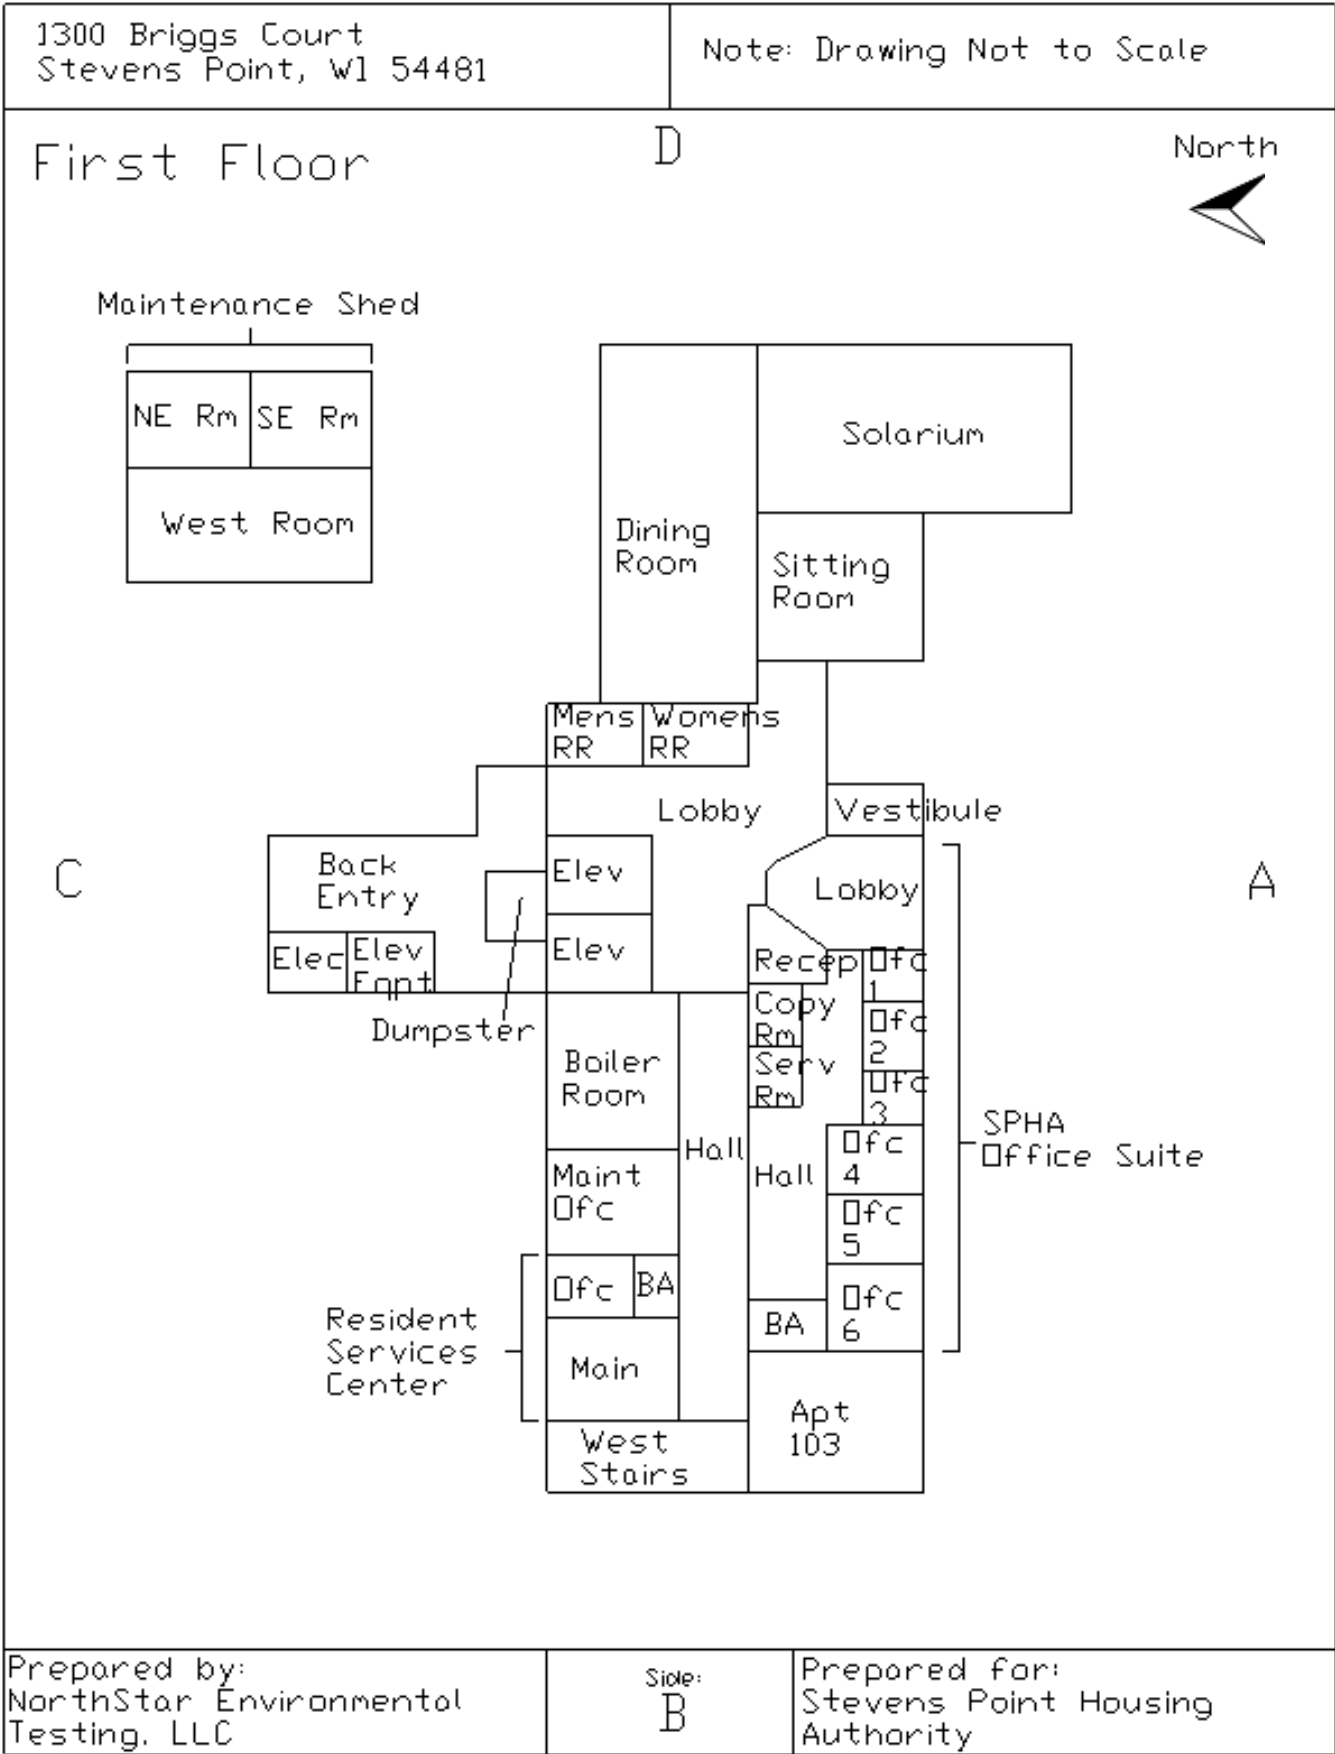

Typical Floor & Apartment Layout – Floors 2 to 7

North 

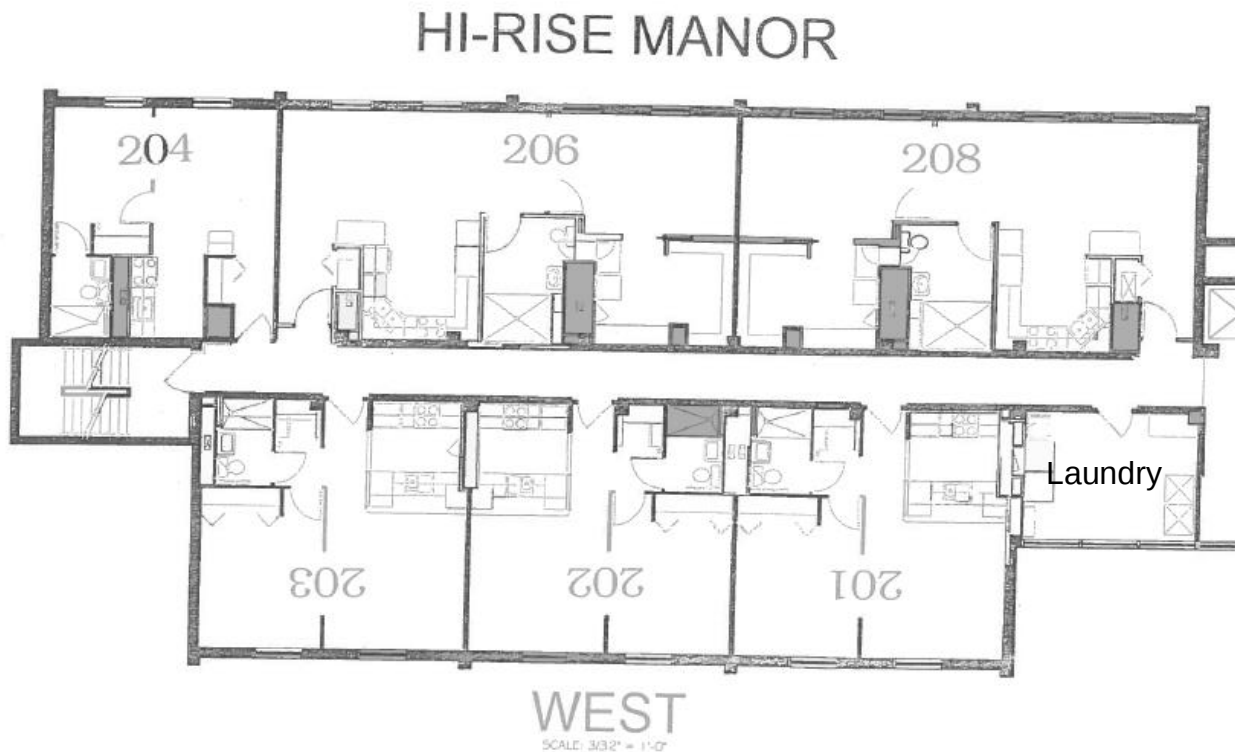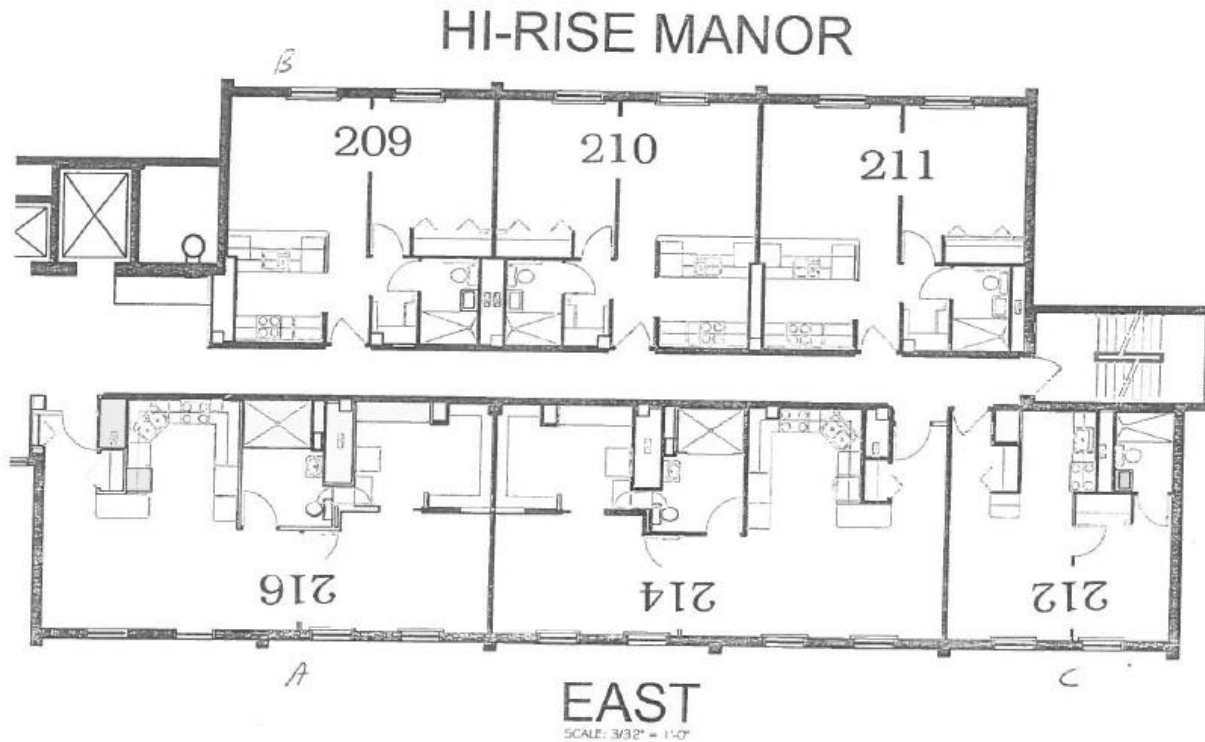

Note: Floors 3, 5, 7 do not have a laundry room. The space depicted as laundry on this diagram is additional hallway space on these floors.

Photo No. 1

Area:
Maintenance Shed – Side B

Item:
Downspout

Contains Lead-Based Paint



Photo No. 2

Area:
Boiler Room – Side C

Item:
Yellow Pipe

Contains Lead-Based Paint

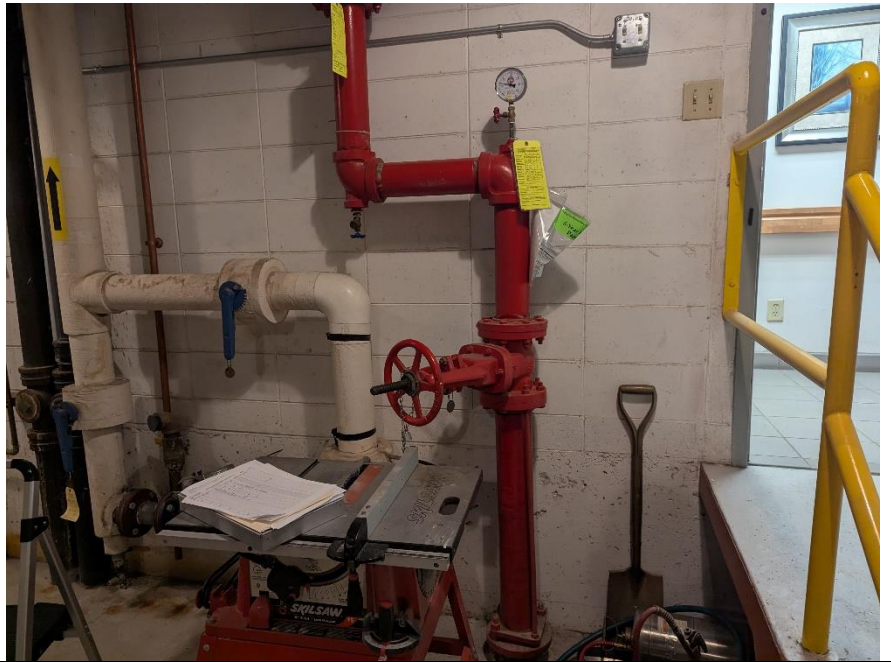


Photo No. 3

Area:
Boiler Room – Side A

Item:
Red Pipe

Contains Lead-Based Paint



NORTHSTAR ENVIRONMENTAL TESTING LLC

1006 WESTERN AVE, MOSINEE, WI 54455-1530 | (715) 693-6112

is a

Certified Lead Company
DHS ID 925800

under Wisconsin Admin. Code ch. DHS 163.

Issued Date: May 30, 2023
Expiration Date: August 1, 2025

COPY



Miriam Hasan

Miriam Hasan
Supervisor, Lead & Asbestos Certification Unit

Wisconsin Department of Health Services
1 W Wilson Street
Madison, WI 53701
608-261-6876 | dhsasbestoslead@dhs.wisconsin.gov